



IMPLEMENTATION OF THE MODEL SAFE SCHOOL PROGRAMME IN THE CARIBBEAN

# HAZARD RISK ASSESSMENT REPORT AND COSTED ACTION PLAN

## BELLES PRIMARY SCHOOL

DOMINICA



An initiative of the African, Caribbean and Pacific Group, funded by the European Union, and implemented by:





**SUBMITTED BY:**

Environmental Solutions Limited

**TO:**

The Caribbean Disaster Emergency Management Agency Coordinating Unit

---

Hazard Risk Assessment Report and Costed Action Plan – Belles Primary School, Dominica for the Consultancy to Develop National Safe School Policies, Assess School Vulnerability to Hazards and Develop School Costed Action Plans in Six Borrowing Member Countries



**CARIBBEAN DISASTER EMERGENCY MANAGEMENT AGENCY COORDINATING UNIT**

Resilience Way, Lower Estate  
St. Michael  
Barbados, W.I.

**REPORT PREPARED BY ENVIRONMENTAL SOLUTIONS LIMITED**



**ENVIRONMENTAL SOLUTIONS LIMITED**

7 Hillview Avenue  
Kingston 10, Jamaica, W.I  
Tel : (876) 978-9519, 978-6297, 978-5902  
Fax : (876) 946-3745  
E-Mail : [envirsol@cwjamaica.com](mailto:envirsol@cwjamaica.com)  
Website : [www.eslcaribbean.com](http://www.eslcaribbean.com)

Original Submission Date: January 17, 2020

Revision Date: June 22, 2020

# TABLE OF CONTENTS

	<b>LIST OF TABLES</b>	<b>4</b>
	<b>LIST OF FIGURES</b>	<b>4</b>
<b>1</b>	<b>INTRODUCTION</b>	<b>5</b>
	1.1 PURPOSE	9
	1.2 METHODOLOGY	9
	1.2.1 HAZARD RISK ASSESSMENT	9
	1.3 LIMITATIONS	13
<b>2</b>	<b>COUNTRY RISK PROFILE/SITUATIONAL CONTEXT</b>	<b>13</b>
<b>3</b>	<b>HAZARD IDENTIFICATION/ASSESSMENT</b>	<b>14</b>
	3.1 HYDROMETEOROLOGICAL	15
	3.1.1 TROPICAL STORMS AND HURRICANES	15
	3.1.2 FLOODS	17
	3.1.3 DROUGHT	18
	3.1.4 STORM SURGE	19
	3.1.5 LANDSLIDE	19
	3.2 GEOLOGICAL	20
	3.2.1 EARTHQUAKE	20
	3.2.2 VOLCANO	20
	3.2.3 TSUNAMIS	20
	3.3 CLIMATE PROJECTIONS	21
<b>4</b>	<b>EXPOSURE ANALYSIS</b>	<b>21</b>
	4.1 OTHER HAZARDS	31
<b>5</b>	<b>ADAPTIVE CAPACITY</b>	<b>32</b>
	5.1 DESCRIPTION OF STRUCTURE	37
	5.1.1 SITE OBSERVATIONS/DISCUSSION	39
<b>6</b>	<b>VULNERABILITY ASSESSMENT</b>	<b>40</b>
<b>7</b>	<b>SUMMARY FINDINGS</b>	<b>40</b>
<b>8</b>	<b>IMPROVEMENT PLAN AND COSTED ACTION PLAN</b>	<b>43</b>
<b>9</b>	<b>REFERENCES</b>	<b>46</b>
<b>10</b>	<b>APPENDICES</b>	<b>47</b>

# LIST OF TABLES

TABLE 1.1	LIST OF SCHOOLS ASSESSED IN DOMINICA	5
TABLE 3.1	HISTORICAL HURRICANES DIRECTLY AFFECTING DOMINICA SINCE 1979 (SOURCE: ACAPS 2018)	15
TABLE 3.2	HISTORICAL STORM EVENTS THAT HAVE CAUSED FLOODING IN DOMINICA	17
TABLE 4.1	PARAMETERS AND RANKINGS USED IN EXPOSURE ANALYSIS (SOURCE: ADAPTED FROM FEMA HAZARD ANALYSIS WORKSHEET)	22
TABLE 4.2	FINDINGS OF THE EXPOSURE ANALYSIS FOR THE BELLES PRIMARY SCHOOL	23
TABLE 5.1	DETERMINANTS OF ADAPTIVE CAPACITY USED IN SCHOOL ASSESSMENT (ADAPTED FROM SMIT ET AL. 2001)	33
TABLE 5.2	SUMMARY OF ADAPTIVE CAPACITY ANALYSIS FOR BELLES PRIMARY SCHOOL (2019)	34
TABLE 5.3	RESULTS OF BUILDING CONDITION ASSESSMENT (MAY 2019)	38
TABLE 8.1	IMPROVEMENT PLAN AND COSTED ACTION PLAN FOR BELLES PRIMARY SCHOOL (MAY 2019)	43
TABLE 10.1	VITAL INFORMATION FOR SCHOOL SAFETY	47
TABLE 10.2	SCHOOL SAFETY ASSESSMENT SUMMARY	48
TABLE 10.3	SAFETY ASSESSMENT SUMMARY SCORES	48
TABLE 10.4	GREEN ASSESSMENT SUMMARY	48

# LIST OF FIGURES

FIGURE 1.1	BELLES PRIMARY SCHOOL	6
FIGURE 3.1	TRACKS OF TROPICAL CYCLONES MOVING WITHIN 150KM OF DOMINICA SINCE 1851 (SOURCE: CCRIF 2013)	16
FIGURE 3.2	INLAND FLOOD HAZARD MAP OF DOMINICA (SOURCE: CIPA 2006)	18
FIGURE 3.3	LANDSLIDE IN THE LAYOU RIVER VALLEY, 1997 (SOURCE: OAS)	19
FIGURE 3.4	IMAGE OF LANDSLIDE IMPACTS IN DOMINICA	19
FIGURE 4.1	DOMINICA WIND HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)	25
FIGURE 4.2	DOMINICA FLOOD HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)	26
FIGURE 4.3	DOMINICA STORM SURGE HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)	27
FIGURE 4.4	DOMINICA LANDSLIDE HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)	28
FIGURE 4.5	DOMINICA EARTHQUAKE HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)	29
FIGURE 4.6	DOMINICA VOLCANO HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)	30
FIGURE 4.7	SAFETY SIGNS TO BE ERECTED AT BELLES PRIMARY SCHOOL (MAY 2019)	31
FIGURE 7.1	IMAGES HIGHLIGHTING SAFETY STRENGTH AT BELLES PRIMARY SCHOOL (MAY 2019)	41
FIGURE 7.2	IMAGE ILLUSTRATING PROXIMITY OF SCHOOL TO MAJOR HIGHWAY AND LACK OF SAFETY SIGNAGE (MAY 2019)	42

# 1. INTRODUCTION

Environmental Solutions Ltd. (ESL) has been contracted by the Caribbean Disaster Emergency Management Agency (CDEMA) to develop/enhance National Safe School Polices in four Caribbean Development Bank (CDB) Borrowing Member Countries (BMCs), conduct hazard assessments of 33 schools across six BMCs, and prepare costed action plans for each of the schools based on the results of the assessments.

This document presents the Hazard Risk Assessment Report and Costed Action Plan for **Belles Primary School, one of ten (10) schools assessed in Dominica**. The report forms a part of the second and fourth deliverables (D2 and D4) under this Consultancy and has been divided into eight main sections. Section 1 describes the method and approach the consultants used to undertake the assessment. Section 2 outlines the Country Risk Profile which presents the natural hazards each country and school is exposed to. Sections 3 to 6 summarize the vulnerability analysis of the identified hazards and Sections 7 and 8 present the summary findings, proposed recommendations and the Costed Action Plan. The results of the school safety and green assessments are presented in the Appendices.

The assessments were conducted during the period May 15 to 31, 2019 (Table 1-1) on regular school days, and as such the consultants were able to assess the schools during normal operational hours. All the schools assessed are designated emergency shelters that may be used during a hurricane or other hazard event.

**TABLE 1.1: LIST OF SCHOOLS ASSESSED IN DOMINICA**

SCHOOL NAME	DATE VISITED
Grandbay Primary	May 15 & 17, 2019
Pierre Charles Secondary	May 15 & 17, 2019
Dominica Community High School	May 15 & 17, 2019
Campbell Primary	May 16 & 17, 2019
Massacre (Canefield) Primary	May 16 & 17, 2019
Castle Bruce Secondary	May 17, 2019
Belles Primary	May 17, 2019
Colihaut Primary	May 17 & 31, 2019
Morne Prosper Primary	May 17 & 31, 2019
Isaiah Thomas Secondary	May 17 & 31, 2019

The assessments consisted of interviews with senior administrators, a site walk-through to make general observations and take pictures, as well as a building condition survey described below.


The results of the school assessments are found in the Appendix.


These deliverables have been prepared for the Project Implementing Agency, CDEMA, as well as the National Safe School Programme Committee (NSSPC) and national focal point in Dominica. The list of NSSPC members are included in Appendix.

The team of assessors visited Belles Primary School on May 17, 2019. The school is located in the parish of St. Joseph (Figure 1-1), and was funded in part by the Maria Holder Memorial Trust. At the time of the assessment, the early childhood school was under construction and all students were being accommodated at the primary school. The school is located in the small community of Belles and sits directly on a major highway, Dr. Nicholas Liverpool Highway. Additional general information on the school and the scores based on the MSSP Assessment Toolkit Checklists can be found in the Appendix.


**FIGURE 1.1: BELLES PRIMARY SCHOOL**



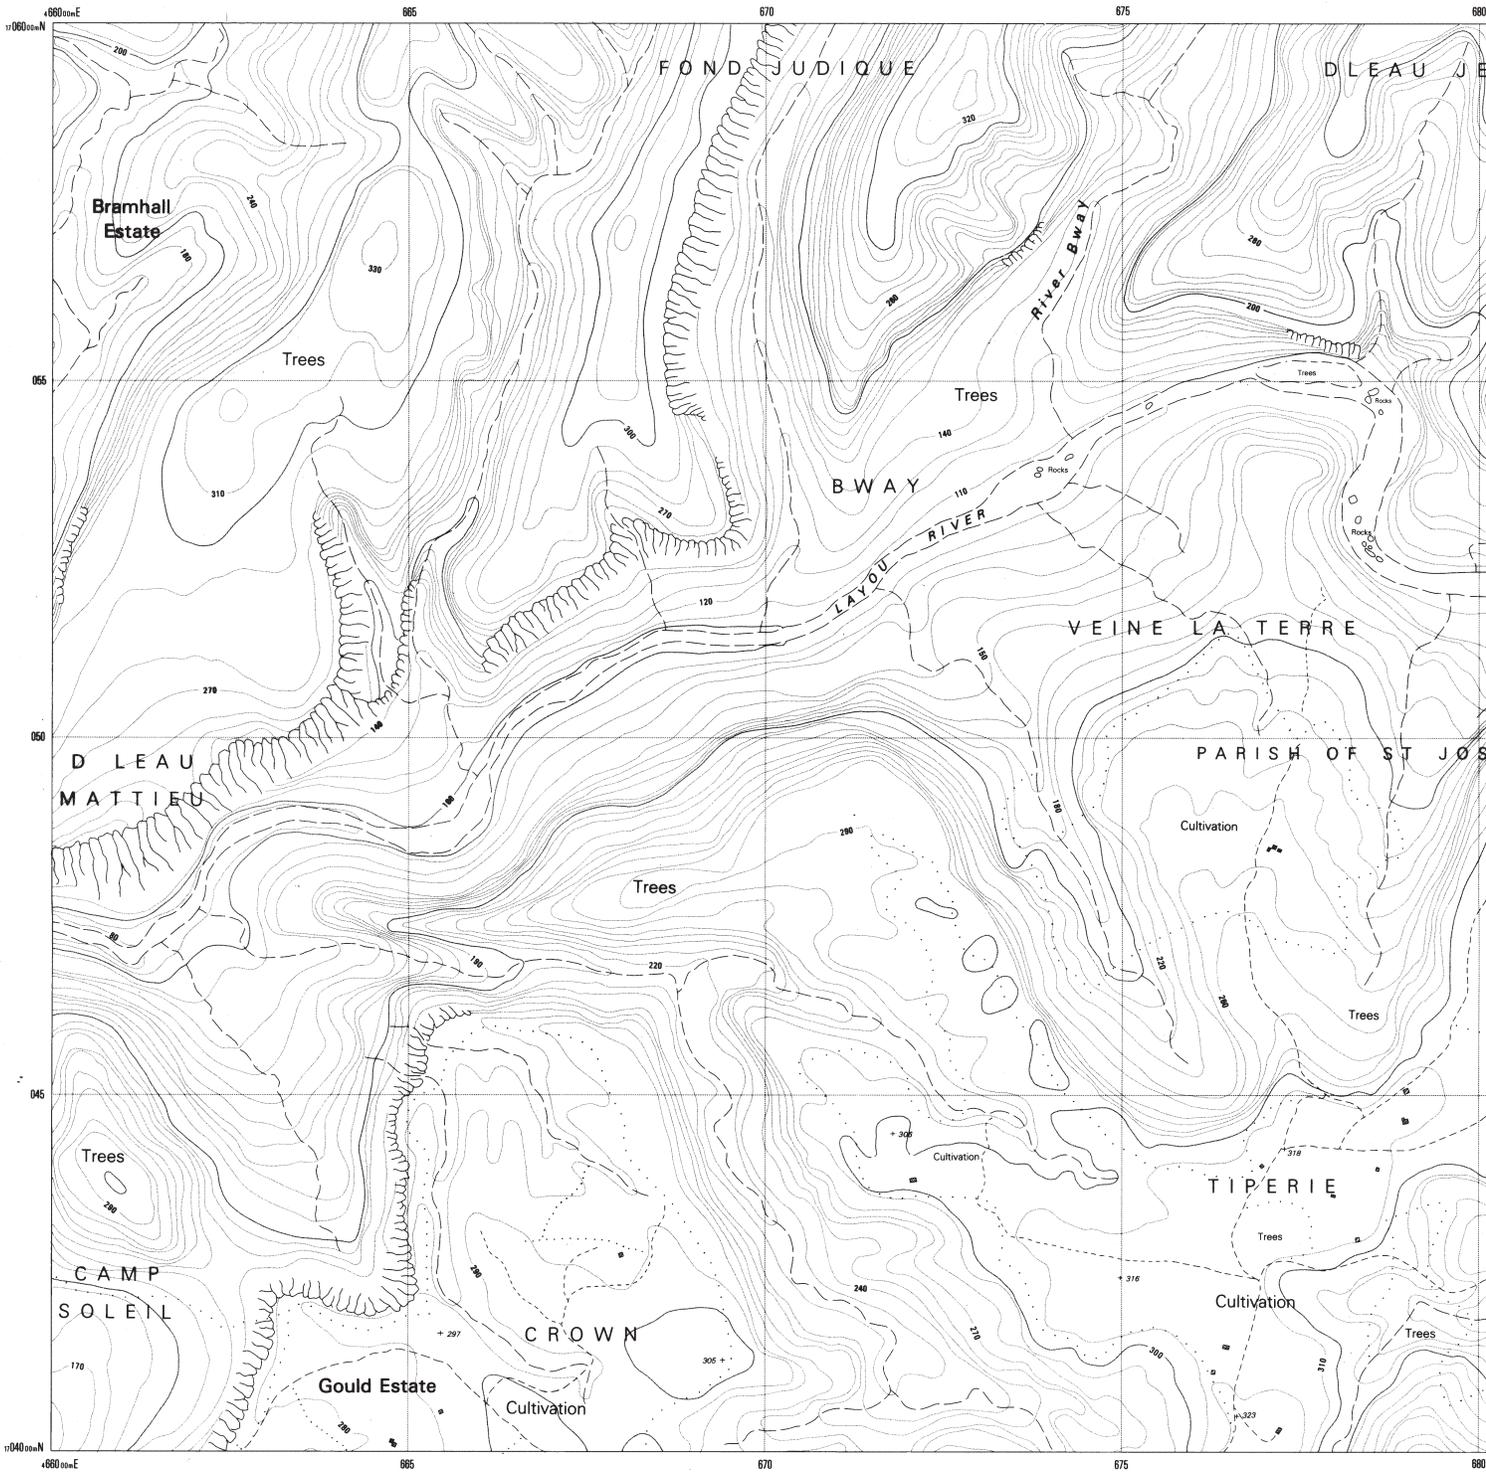


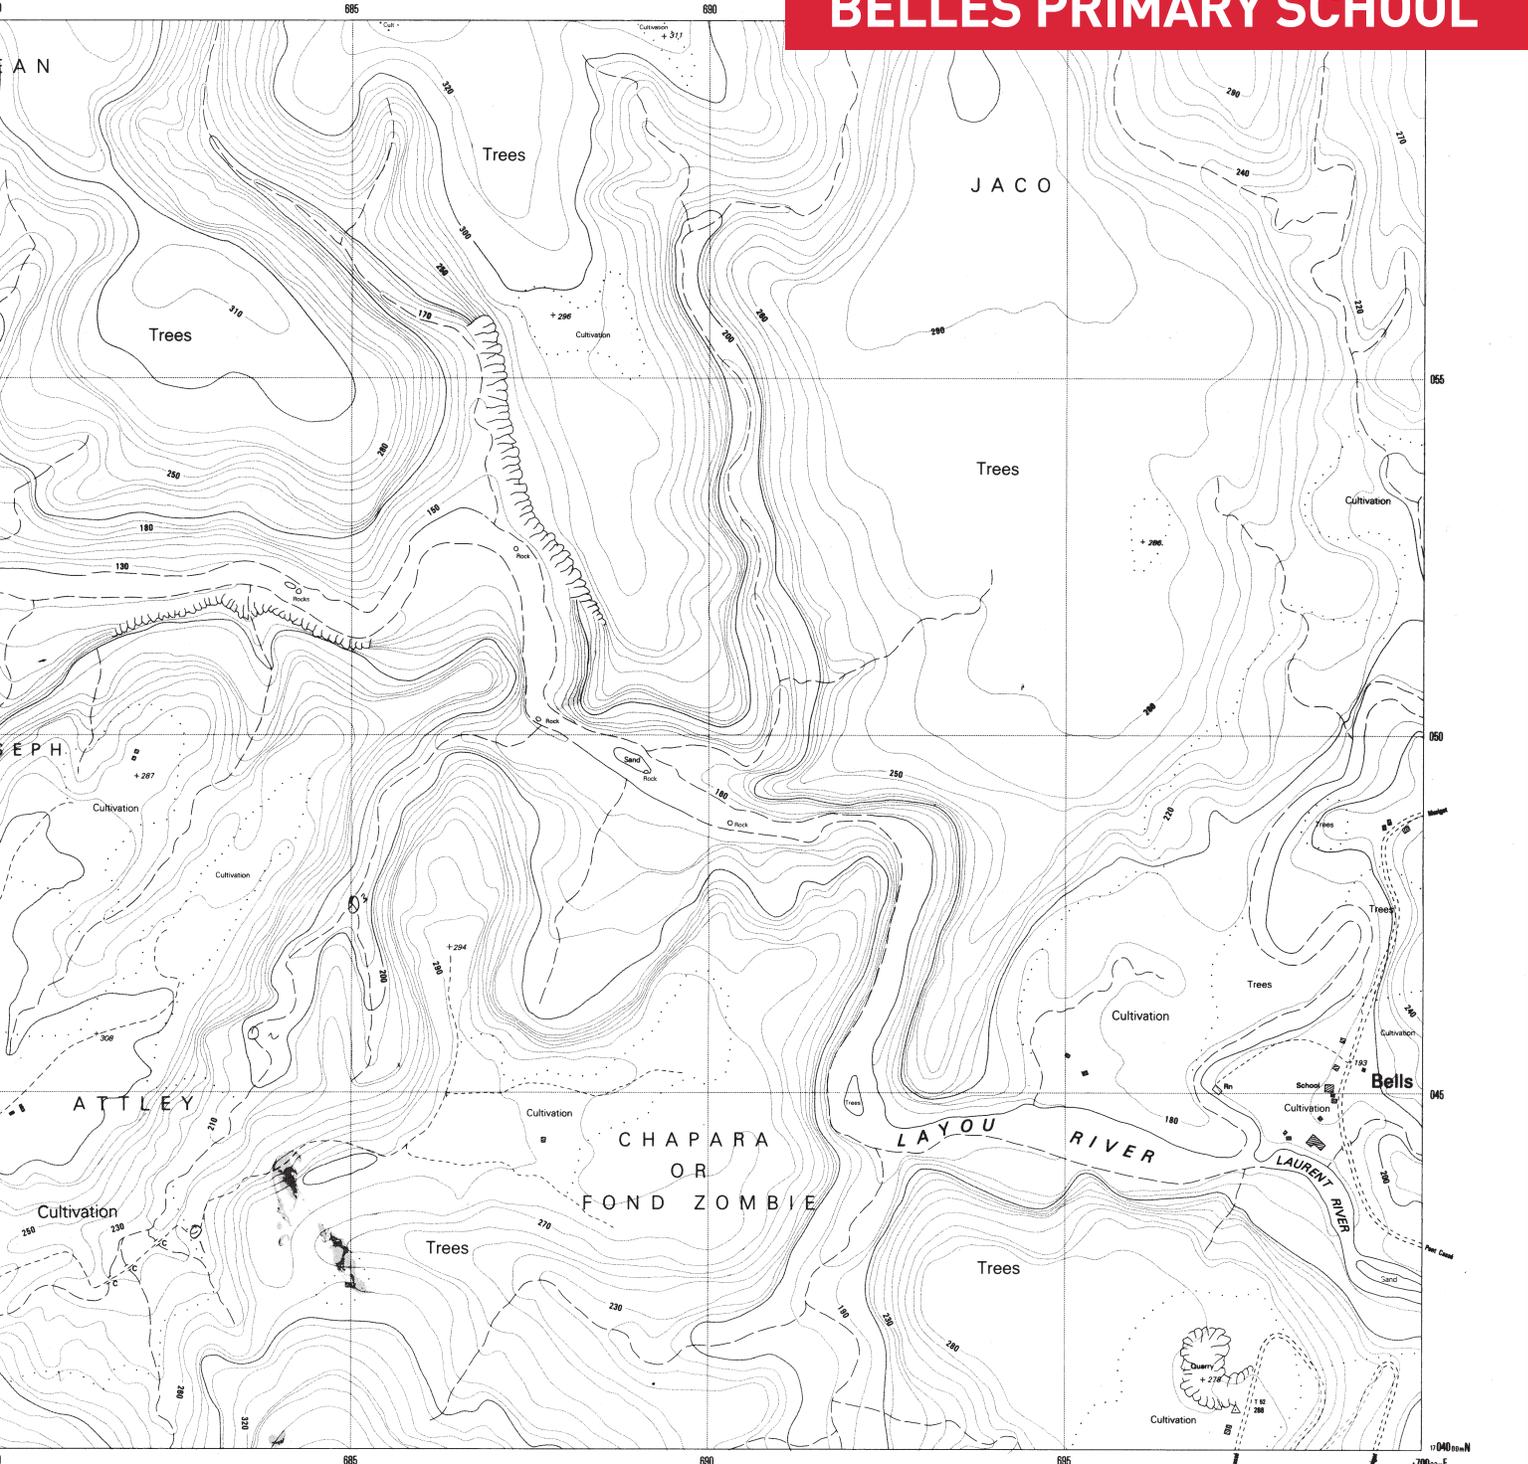

Scale 1:5,000

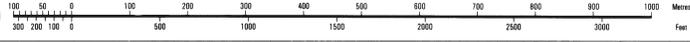

Conversion Table

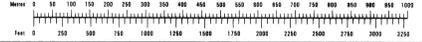

**Publication**  
Published by the Government of the United Kingdom (Ordnance Survey) for the Government of Dominica.  
© GOVERNMENT OF DOMINICA 1989

**Sales**  
Outline copies of this map can be obtained from:  
Lands and Surveys Department,  
Ministry of Agriculture, Lands and Fisheries,  
Bath Estate,  
Roseau,  
Dominica.

**Geographical Position**  
The position of the S.W. corner of this sheet is:-  
Longitude 15° 24' 53.38" West of Greenwich  
Latitude 61° 23' 05.46" North

**Height Depiction**  
Heights in metres  
Contours are shown at 10m vertical interval up to 600m and 20m vertical interval thereafter.  
The accuracy of contours cannot be guaranteed in areas of high vegetation.  
Contours are shown through buildings for the purpose of continuity only.

**Sheet History**  
Edition 1 prepared by the Overseas Surveys Directorate, Ordnance Survey under the UK Government's Technical Cooperation Programme.  
Field survey data by Directorate of Overseas Surveys, February 1985 and January 1987.  
Air photography by J. A. Story and Partners, January 1971.  
Field completion by Lands and Survey Department, July 1988.

**Additions or Corrections**  
Users noting additions or corrections are asked to mark them on the map and send it to:-  
Director of Survey and Commissioner of Lands, Lands and Survey Department,  
Ministry of Agriculture, Lands and Fisheries,  
Bath Estate,  
Roseau,  
Dominica.  
The map will be replaced.

**General Information**  
The representation of a road or track is no evidence of the existence of a right of way.  
Buildings are shown according to their roof outline.

**Symbols/Abbreviations**

△	Trigonometrical station	---	Line of trees
318	Spot height	---	Track
+ 20	Photogrammetric spot height	---	Footpath
+	Bench mark	---	Well
356	Contours	---	FB
---	Depression contour	---	Slope
---	Wall, Fence, Hedge	---	D
---	Indefinite watercourse	---	Drain, Ditch
---	Vegetation boundary	---	WD
---	Indefinite vegetation boundary	---	Wide drain
---	Cliff	---	C
---	Sleep Slope	---	Culvert
---	Slip	---	P
---	Tree suspected of obscuring detail	---	Post, Pole
		---	WT
		---	Water Tank
		---	UC
		---	Under construction
		---	Ch
		---	Church
		---	Mx
		---	Mosque
		---	Sch
		---	School

**Index to Adjoining Sheets**

10/0206		10/7006	
5/6204	5/6604	10/7002	
5/6202	5/6602		

**Grid Data**  
Grid:- British West Indies  
Projection:- Transverse Mercator  
Spheroid:- Clarke 1880 (Modified)  
Unit of Measurement:- Metre  
Meridian of Origin:- 62° West of Greenwich  
Latitude of Origin:- Equator  
Scale Factor of Origin:- 0.9995  
Scale Factor of Origin:- 400,000m Easting  
False Co-ords of Origin:- Nil Northing  
Datum:- M12 Astro 1945 (1983 adjustment)

## 1.1 PURPOSE

The Model Safe School Programme (MSSP) Toolkit states that “in a region that is prone to various hazards, many schools may be located in hazardous locations. Wherever possible, Hazard and Vulnerability Assessments should be performed for schools to guide the inclusion of preparedness and mitigation measures in the design, construction and operational phases. Disaster and emergency planning should be founded on a thorough understanding of the specific hazards faced by the education sector in general and at the individual institutions.”

The purpose of this hazard assessment report is to identify and analyse the hazard vulnerability of **Belles Primary School** and to make recommendations to inform decision-making.


## 1.2 METHODOLOGY

The vulnerability assessment tool (VAT) draws on the methodology developed by the National Oceanic and Atmospheric Association (NOAA). Some adaptations were made to consider the local situation as well as data quality and availability.

### 1.2.1 HAZARD RISK ASSESSMENT

The consultants undertook the hazard risk assessments through a 3-step process elaborated below.

#### 1.2.1.1 STEP 1 - CHARACTERIZING HAZARDS

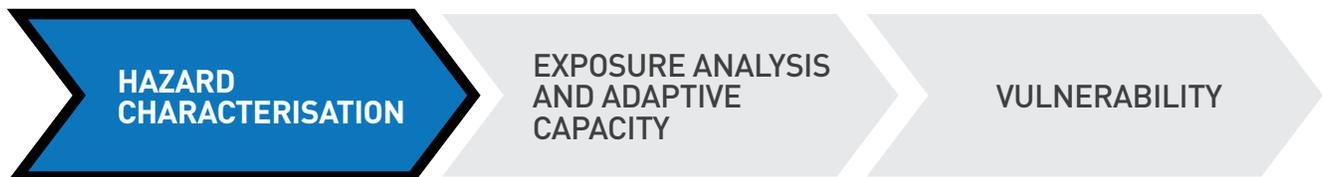

The first step involved the identification of the hazards (hydro-meteorological, geological, etc.) to which each of the countries, and by extension each school, may be exposed. To characterise hazards for each country, the Consultants conducted comprehensive desk research and stakeholder consultations with key agencies and various stakeholder groups to acquire the necessary information, which included but was not limited to:

- Existing spatial data from local and regional Geographic Information Systems (GIS) databases e.g. Caribbean Risk Information System, CHARIM Handbook & Geo-node, PITCA, CARDIN etc.
- Multi-hazard maps, including:
  - Wind and cyclone hazard maps
  - Seismic zoning
  - Flood hazard maps
- Location of critical infrastructure and supporting infrastructure
- Historical and projected information on hazards for each country
- Damage history of each institution
- Previously conducted studies or country reports

Site visits were also conducted to the respective schools. These visits focused primarily on collecting physical infrastructure data and assessing the vulnerability of the facilities as they relate to the various hazards.

## 1.2.1.2 STEP 2 - EXPOSURE ANALYSIS AND ADAPTIVE CAPACITY



### EXPOSURE ANALYSIS

Exposure analysis involved accessing various databases, including geospatial mapping using GIS, to identify the hazards to which the schools were exposed, as well as site assessments and discussions with stakeholders to ascertain history of hazard events.

Mapping hazard exposure enables stakeholders to visualise individual hazardous settings and identify cumulative hazard scenarios. This mapping also provides an effective tool to anticipate, plan and manage resources effectively in advance of these hazards. This geospatial framework is the foundation of the vulnerability assessment process.

The Consultants used the assessment tools from the MSSP toolkit to gather relevant information to help to inform exposure.

## ADAPTIVE CAPACITY ASSESSMENT

The adaptive capacity for each school was determined by examining the characteristics that influence the school's capacity to prepare for, respond to and recover from hazards and disasters. The interaction between natural processes and the built environment is intrinsically linked, and it is the adaptive capacity that determines the risks and burdens created by hazards.

Some of the major factors assessed that influence adaptive capacity included:

- Are the proposed systems associated with each asset/facility designed to anticipate a hazard, cope with it, resist it and recover from its impact?
- Conversely, are there barriers to the ability to anticipate, cope, resist or recover?
- Are the systems associated with the school's assets/facilities already stressed in ways that will limit their capacity to anticipate, cope, resist or recover?
- Is the rate of impact from hazards likely to be faster than the adaptability of the systems?
- Are there efforts already underway to address impacts of hazards of interest related to the school's assets/facilities?

These variables outlined above were adopted for this project along with other indices. A systematic examination of building elements (as elaborated below), facilities, population and other components was carried out to identify features that are susceptible to damage from the effects of specific hazards. A qualitative scoring method was developed to determine the vulnerability of specific structures, exposed population and selected geographic areas. This data was analysed and used to prioritize mitigation activities and to guide disaster risk management within the schools.

The Consultants conducted targeted interviews with school administrators to identify gaps and needs for each school (institutional framework, physical infrastructure, human and financial resources). During the adaptive capacity analysis, the Consultants used the MSSP toolkit to identify gaps, needs and recommendations for capacity building measures and other interventions. Additionally, the Consultants provided a qualitative summary for each school.

### Building Condition Assessment Methodology

The structural condition assessment was limited to visual observations and included both non-structural and structural-related issues. No finishes were removed to reveal hidden conditions, and no material or load tests were conducted to ascertain the structural capacity of the buildings' components. Moreover, the survey was limited to cursory inspection of electrical and mechanical systems such as ventilation, water services, plumbing and sewer utilities; egress, fire-suppression, or fire rating of the building components.

As such, any comments offered regarding concealed construction are the professional opinions of the Consultants based on analyses, and our joint engineering experience and judgment, and are derived in accordance with the standard of care and practice for evaluations of building structures.

The following standard conditions assessment definitions were used in describing the general state of the elements.

**Good condition:**

- It is intact, structurally sound and performing its intended purpose.
- There are a few or no cosmetic imperfections.
- It needs no repairs and only minor or routine maintenance.

**Fair condition:**


- There are early signs of wear, failure or deterioration, although the feature or element is generally structurally sound and performing its intended purpose.
- There is failure of a sub-component of the feature or element.
- Replacement of up to 25% of the feature or element is required.
- Replacement of a defective sub-component of the feature or element is required.

**Poor condition:**

- It is no longer performing its intended purpose.
- It is missing.
- It shows signs of imminent failure or breakdown.
- Deterioration or damage affects more than 25% of the feature or element and cannot be adjusted or repaired.
- It requires major repair or replacement.

The above was used qualitatively in conjunction with CDEMA's Enhanced Building Condition Assessment Tool (EBCAT) and the findings are contained in Section 5.1.

### 1.2.1.3 STEP 3 - VULNERABILITY ASSESSMENT

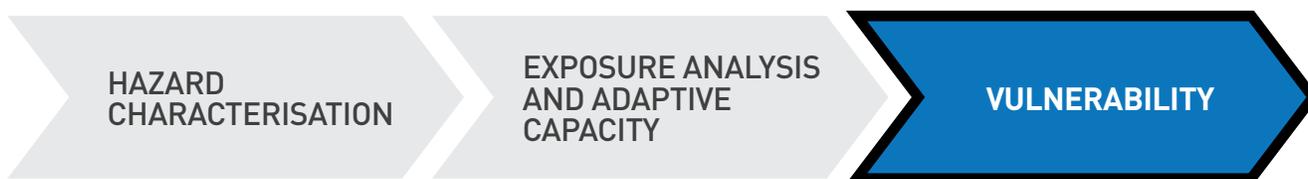

The data and information collected from Step 1 (Hazard Characterisation) and Step 2 (Exposure Analysis and Adaptive Capacity) were combined to determine how and where each school is vulnerable to hazards using the following formula:

$$\text{HAZARD EXPOSURE} + \text{ADAPTIVE CAPACITY} = \text{VULNERABILITY}$$

## 1.3 LIMITATIONS

This assessment represents a one-day snapshot of the school that may or may not be the total depiction of what occurs daily. The team based its findings on the data provided and individual observations made during this one-day time frame. Please be mindful that this assessment is not binding but is merely an independent review to assist school officials in their quest to examine practices and procedures to better serve their student population. It is therefore incumbent upon the Ministry of Education, education officers and school staff to consider the report and determine what they believe is legitimate and critical to address when considering school safety management issues.

Comments in this report are intended to be representative of observed conditions. The consultants have made every effort to reasonably inspect and analyze the main structural components as well as the non-structural components which form part of the building envelope. If there are perceived omissions or misstatements in this report regarding the observations made, we ask that they be brought to our attention as soon as possible so that we can address them fully and in a timely manner.

## 2. COUNTRY RISK PROFILE / SITUATIONAL CONTEXT

Dominica, officially the Commonwealth of Dominica, is the largest, most northerly island of the Windward Islands in the Eastern Caribbean Sea, located northwest of Martinique and south-southeast of Guadeloupe. The island occupies an area of 750.6 km<sup>2</sup> (48km long and 24km wide) and is characterised as a mountainous and volcanic island with steep terrain features. The cone of highest point on the island, Morne Diablotin (1,447m), dominates the topography of the north. A chain of mountains including Morne Tros Piton (1,424m), Morne Micotrin, Morne Anglais and Morne Plat Pays covers the southern half of the island (ECU 2001). The more gently sloping areas of flat land are restricted to the northeastern coast, in river valleys and in the Belle's Wet Area in the centre of the island (ECU 2000). The island is known as "The Nature Island" of the Caribbean, hosting several perennial streams, rivers, waterfalls and lakes including the world's second largest hot spring, Boiling Lake.

The population of Dominica is estimated to be 71,293 (2011 census) and has experienced net zero growth or declines in population over the past three decades due largely to emigration. Steeply dissected, mountainous terrain found in Dominica's centre means most population centres are located along mountain tops and stream valleys, with nearly 90% of the population found in settlements along the coastal fringe of the island (GFDRR 2010). Approximately 67% of the population resides in urban areas (ECLAC 2010) and it is estimated that 28% lived in the capital Roseau, 5% in Portsmouth and 4% in Marigot (Poverty Research Unit, 2006), all coastal settlements.

# 3. HAZARD IDENTIFICATION/ASSESSMENT

As with many other countries in the Caribbean, there are two broad categories of hazards that can cause potentially minor to significant impacts at any given time in Dominica:

- Hydro-meteorological hazards
  - Hurricanes and Tropical Storms
  - Flooding
  - Drought
  - Storm Surge
  - Landslide
  
- Geological hazards
  - Earthquake
  - Volcano
  - Tsunami

Based on a review of reports, site visits and consultation with the key stakeholders at each school and the Ministry of Education, Dominica is at risk to impacts from all of the above hazards and is ranked as one of the 10 most susceptible countries in the Caribbean relative to total number of events (CRED 2000). The steep slopes of the volcanic hills pose the risk of landslides and volcanic eruption, and with 90% of the population living within 5 km of a live volcano, that risk is quite extreme (GFDRR, 2010). Dominica has 9 of the 16 active volcanoes in the Caribbean making the risk of volcanic event quite serious (Kairi Consultants Ltd, 2010). In addition, the tropical climatic conditions on the island mean that heavy rainfall and flooding is possible any time of year. Heavy rainfall associated with tropical storms and hurricanes can, and has, also caused significant flooding damage and high wind damage. Additionally, storm surge and coastal erosion pose significant threats to the dense, developed coastal areas, not only during hurricanes but also from regular storm activity. This is compounded by the poor roads and high frequency of landslides which can and has isolated persons living in major centres.

## 3.1 HYDROMETEOROLOGICAL

### 3.1.1 TROPICAL STORMS AND HURRICANES


Dominica is in the Caribbean, one of the most disaster-prone regions in the world. Since 1950, over 13 named tropical storms have passed within 40km of the island. Since 1979, Dominica has been impacted by over 15 tropical systems including 12 hurricanes. Given that most of Dominica's population and infrastructure are located along the coast, they have experienced severe damage and losses in the past from strong winds and high seas (ODI 09/2001). Several hurricanes are notable as they required humanitarian assistance for recovery:

- **Hurricane Maria (September 2017):** a category 5 hurricane, Maria produced wind speeds of 160mph (with higher gusts), intense storm surges and rainfall and overflowing of rivers that resulted in 31 people deaths, 37 missing people and major destruction of critical infrastructure. It is estimated that over 90% of the population was directly affected; up to four months following the hurricane, approximately 450 people were still in shelters, 15% of children has not yet returned to school and 90% of the population remained without electricity.
- **Tropical Storm Erika (August 2015):** Dominica suffered major infrastructural damage in the wake of Erika, primarily related to transportation, households and agriculture. The island experienced heavy rainfall of up to 850mm in less than 12 hours. The mountainous terrain, excessive moisture and ground saturation from previous rains caused river basins to overflow and triggered flooding and landslides that displaced thousands and killed up to 30 people (CDEMA 30/08/2015).
- **Tropical Storm Ophelia (September 2011):** the country experienced more than 80mm of rainfall in six hours, damaging the towns of Massacre, Canefield, Mahaut, Cochrane, Coulibistrie and Campbell most severely (Dom hazard profile).
- **Hurricane David (August 1979):** this category 5 storm produced heavy rainfall and major landslides causing the most damage in areas in the southwest and the capital of Roseau. Most of the country's population was displaced following the hurricane as more than 80% of homes on the island were destroyed.

**TABLE 3.1: HISTORICAL HURRICANES DIRECTLY AFFECTING DOMINICA SINCE 1979 (SOURCE: ACAPS 2018)**

NAME OF EVENT	YEAR	AFFECTED	DEATHS
Maria	2017	65,000	31
Erika	2015	15,951	13
Ophelia	2011	240	0
Dean	2007	7,530	2
Marilyn and Luis	1995	5,001	2
Hugo	1899	710	0
David and Frederick	1979	72,100	40

FIGURE 3.1: TRACKS OF TROPICAL CYCLONES MOVING WITHIN 150KM OF DOMINICA SINCE 1851 (SOURCE: CCRIF 2013)

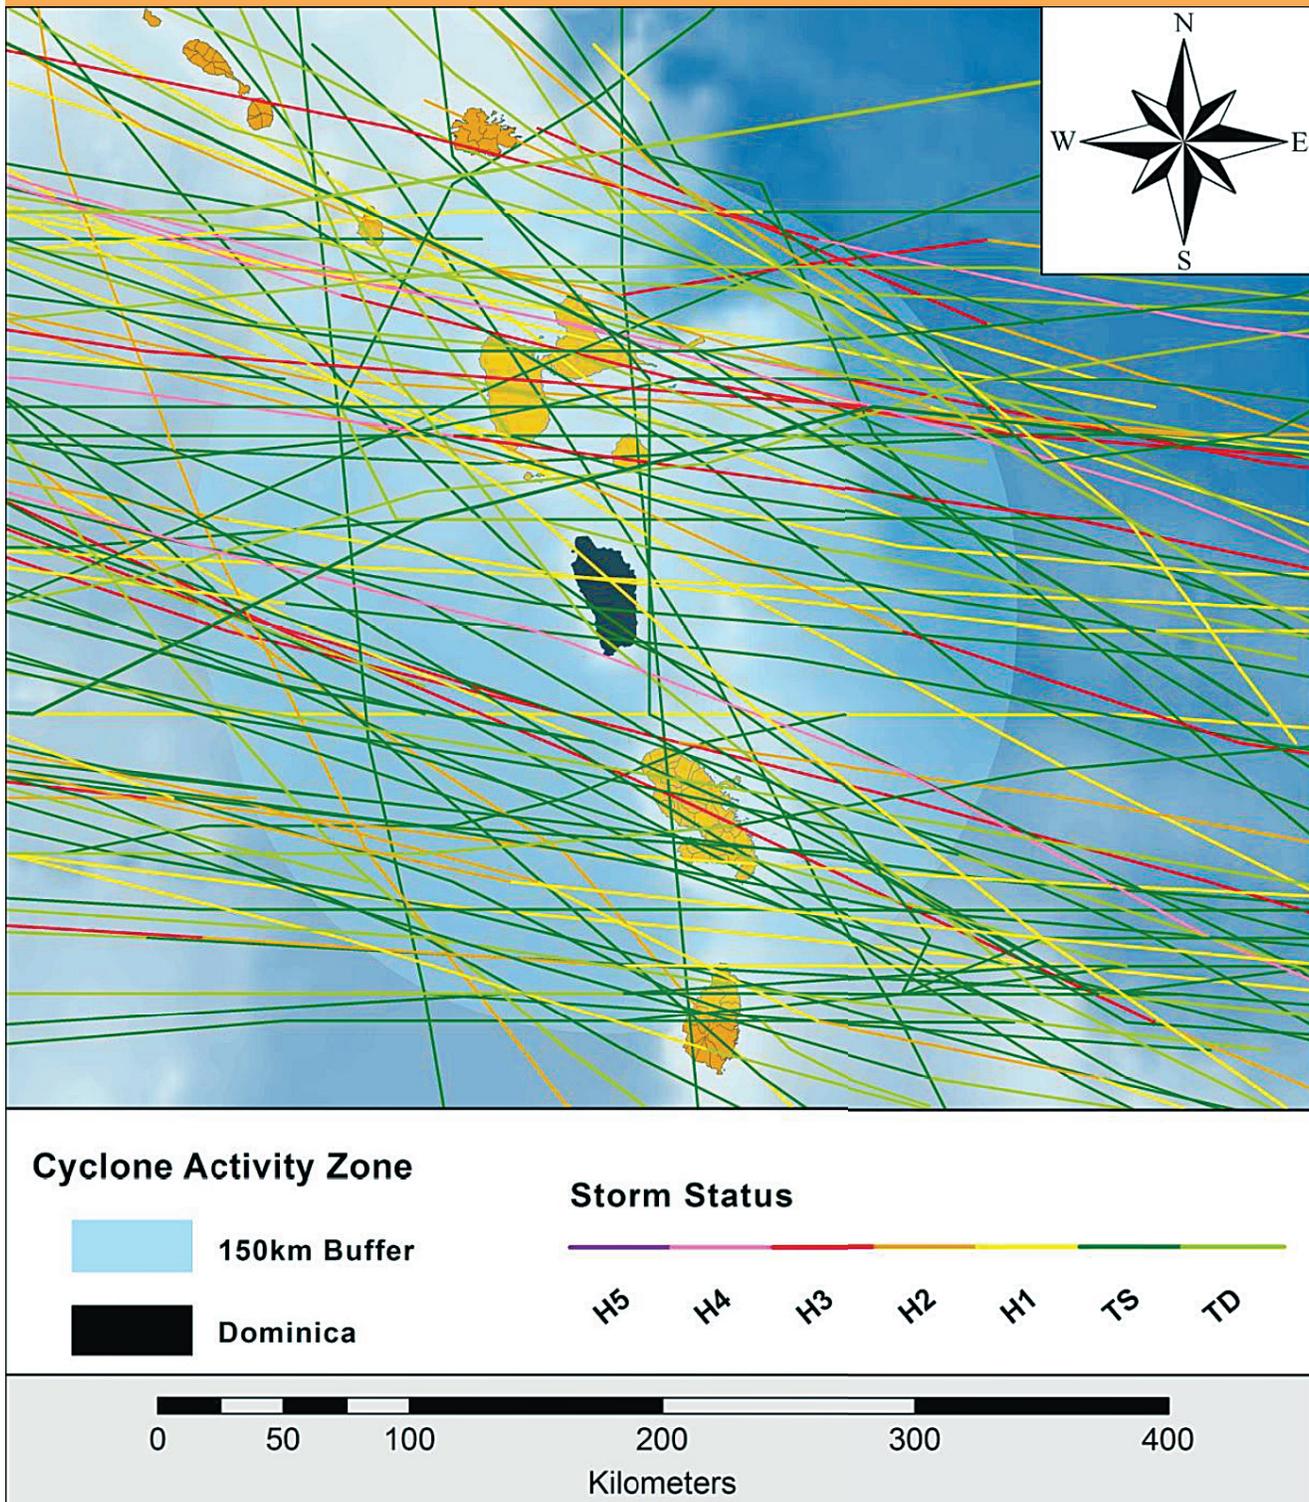

## 3.1.2 FLOODS


Flooding is a recurrent, annual problem in Dominica particularly as most development has occurred along the coast. Heavy rainfalls associated with tropical storm and hurricanes can trigger flooding. The island also experiences some of the highest annual rainfall amounts in the region, heavily influenced by orographic effects. Dominica is characterized as one of the wettest islands in the Caribbean and humidity is generally above 85% in the interior. The average annual rainfall in the driest section of the island (central west coast) is 1,270mm while the central peaks can receive over 7,620mm (ECU 2001). The combination of rainfall, steep, mountainous terrain and the island's geology means flash floods are also a constant threat, as materials and debris from landslides and soil erosion compromise the hydraulic capacities of river channels.

During the 1998 – 2015 period, eleven (11) significant excess rainfall events impacted Dominica, all caused by hurricanes and tropical storms. In December 2013, a low-level trough produced severe rains and high winds that caused flooding and landslides on the island, affecting hundreds of people, mainly in the south. Hurricane Dean in 2007 caused flooding in Dominica particularly in Roseau, where there was a 1 in 4-year, 24 hour rainfall event (risk atlas).

**TABLE 3.2: HISTORICAL STORM EVENTS THAT HAVE CAUSED FLOODING IN DOMINICA**

NAME OF EVENT	CATEGORY	YEAR
<b>Maria</b>	Category 5 Hurricane	2017
<b>Erika</b>	Tropical Storm	2015
<b>Chantal</b>	Tropical Storm	2013
<b>Isaac</b>	Tropical Storm	2012
<b>TC5</b>	NA	2011
<b>Emily</b>	Tropical Storm	2011
<b>Dean</b>	Category 1 Hurricane	2007
<b>Iris</b>	Tropical Depression	2001
<b>Lenny</b>	Tropical Storm	1999
<b>Jose</b>	Category 1 Hurricane	1999
<b>Georges</b>	Category 3 Hurricane	1999

**FIGURE 3.2: INLAND FLOOD HAZARD MAP OF DOMINICA (SOURCE: CIPA 2006)**

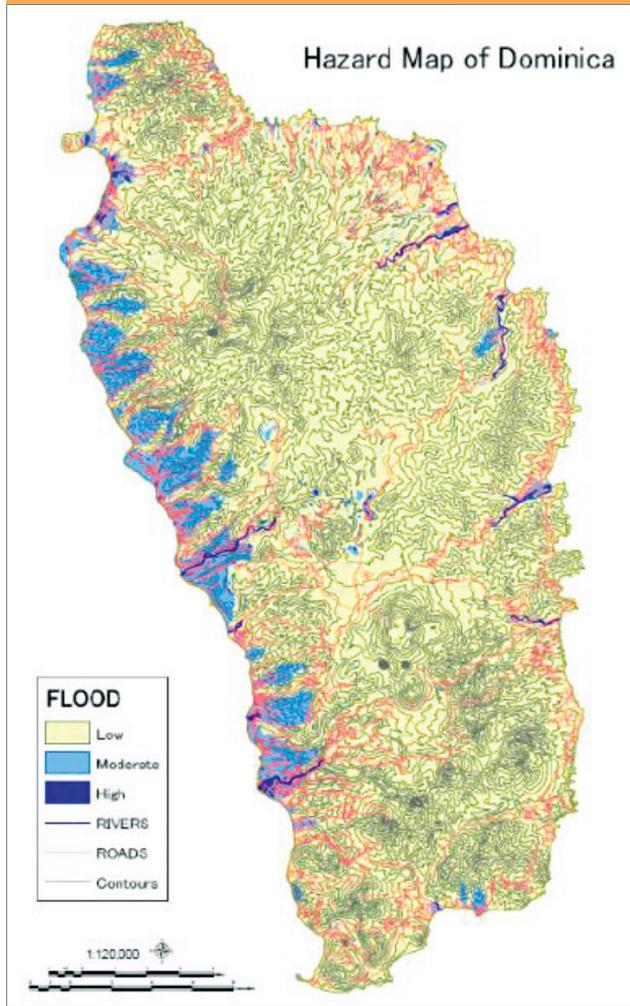

Settlements along the Layou River, the longest and deepest river in Dominica, are highly susceptible to flooding as the river is prone to flooding. In 1997, landslides due to heavy rainfall effectively blocked the discharge of the Matthieu river to the Layou, some 6km northeast from the mouth of the Layou. The subsequent failure of the Matthieu dam resulted in major flooding and damage of the downstream portions of the Layou river, particularly along the Layou Valley to the western coast. Since then, a lake known as Miracle Lake has formed due to a stabilization effect of the landslide over time, however this large volume of water still presents a flood threat to the Layou Valley.

### 3.1.3 DROUGHT

Drought is a potential hazard facing Dominica as the country depends almost entirely on rain-fed surface water for its freshwater supply. Hence, variations in rainfall can lead to dry spells and periods of drought. The country has experienced severe drought conditions in 2001 and between October 2009 – January 2010 (Simpson 2014).

As a result of a strengthening El Niño contributing to reduced rainfall, a drought warning was issued for Dominica in 2018 and 2019. During these dry spells, stream flow can be as low as 30% of the average rainy season flows, which can adversely impact the country's economy. During dry spells and periods of drought, the increased risk of forest and brush fires can intensify land degradation and affect the quality of water catchments, while increased temperature in rainforest can reduce catchment flows.

### 3.1.4 STORM SURGE

Dominica's coastline is exposed to storm surge where storm waves can produce major damages. During Hurricane Maria (2017), wind speeds reached 160mph with higher gusts producing intense storm surges.

### 3.1.5 LANDSLIDE

Similar to flooding, Dominica's combination of rainfall, geology and severe topography makes the island particularly favorable to the development of various types of landslides (GFDRR). The most common landslides are debris flows and roads and villages are under constant threat from rock falls and debris slides presented by the island's steep cliffs. Landslides typically occur along river courses which can lead to temporary pooling of water, which contribute to flood risks. At least 2% of the total land area has been disturbed by landslides (ODI 09/2001) while 35 people lost their lives due to landslides that occurred between 1925 and 2015.

The Good Hope landslide on Dominica is one of the larger identified debris slides (DeGraff, 1987). The community located on the east coast had experienced several days of rainfall, which triggered nearly 17000 m<sup>3</sup> of soil and weathered rock to slide from the hillslope above Castle Bruce-Petit Soufriere road. The landslide resulted in major damages to roads, schools, critical infrastructure, injured several residents and caused one fatality. In 2010, heavy rainfalls produced a landslide in Bayside, San Sauveur, claiming the lives of 3 persons. According to a large-scale landslide inventory conducted by the University of Twente in 2018, Hurricane Maria triggered a total of 9,960 landslides (8,576 debris slides, 1,010 debris flows and 374 rock falls). As discussed previously (Section 3.1.2), the 1997 landslide in the Layou River Valley was a major landslide and presently remains active at the confluence of Matthieu and Layou rivers.

**FIGURE 3.3:  
LANDSLIDE IN THE  
LAYOU RIVER VALLEY, 1997  
(SOURCE: OAS)**



**FIGURE 3.4:  
IMAGE OF LANDSLIDE  
IMPACTS IN DOMINICA**



## 3.2 GEOLOGICAL

### 3.2.1 EARTHQUAKE

Dominica is considered to be the most geologically active island in the Caribbean and is located in a moderately active sector of the eastern Caribbean Plate margin. Earthquakes originate from plate movements (tectonic) and/or magma displacement (volcanic activity) – in Dominica’s case, earthquakes are common and typically linked to volcanic activity. The island suffers from numerous shallow, potentially damaging volcano-tectonic earthquake swarms and trends indicate that earthquakes on the island are trending towards being stronger and shallower. This suggests that Dominica is at increased risk of magmatic eruption(s). Earthquake risk is considered moderate (CRIFF 2013), with the potential for local amplification for coastal areas. Dominica’s capital city, Roseau, is also prone to shallow volcano seismic swarms.

The island is also exposed to impacts from earthquakes associated with plate activity. During the period 1998 – 1999, 183 movements were recorded in one day on October 23, 1998 (ECU, 2001). Earthquakes in 2004 and 2007 were located offshore but were of sufficient magnitude (6.3 and 7.4 respectively) to be felt throughout the entire region. The event in 2004 coincided with a three-day period of heavy rainfall and triggered several landslides throughout the island.

Seismic activity also has the secondary risks of landslides, particularly given Dominica’s steep terrain.

### 3.2.2 VOLCANO

Dominica is the only Caribbean island that has more than one volcano, with 9 of the 16 potentially active volcanoes in the region found there: Morne au Diable, Morne Trois Pitons, Morne Diablotins, Morne Watts, Morne Anglais, Wotten Waven Caldera, Valley of Desolation, Grande Soufriere Hills and Morne Plat Pays. It is estimated that over 90% of the population live within 5 km of a live volcano (ECU, 2001). As such the entire island is susceptible to volcanic hazards however studies indicate that the capital Roseau is situated in one of the most hazardous areas of the island<sup>1</sup>.

In the past there have been two steam explosions in the Valley of Desolation (Morne Trois Pitons National Park), one in 1880 and subsequently in 1997. Following a volcanic alert in 1998-9, its susceptibility to future volcanic activity is also currently a major cause for concern. Volcanic activity can also trigger earthquakes as discussed in Section 3.2.1.

### 3.2.3 TSUNAMIS

Tsunamis are not considered a major recurrent risk for the Caribbean region, however the low-lying nature of coastal developments and the concentration of the population and critical infrastructure in coastal settlements make them vulnerable to tsunami activity (GFDRR 2010).

1 <http://caribbeanvolcanoes.com/dominica-geology/>

## 3.3 CLIMATE PROJECTIONS

In 2017, Dominica was listed as one of the countries most affected by impacts of weather-related loss events (storms, floods, heat waves etc.) (Germanwatch Global Climate Change 2019 Risk Index.3) mainly due to two factors: (i) the impact of global warming on rising sea levels which are associated with an increased risk of storm surges, and (ii) the increase in the intensity of hurricanes. Similar to the rest of the Caribbean region and consistent with the projected global median, climate change models project that Dominica will trend towards warming and drying and is expected to suffer more frequent heat waves and droughts, increased high intensity rainfall and rising sea levels. The Government of the Commonwealth of Dominica has identified sea level rise (SLR), changes in temperature and precipitation, and impacts from hurricanes and extreme events as the major issues of climate change facing Dominica.

In summary the following is noted about the climate of Dominica (ECU, 2012):

- There is evidence to suggest that the climate of Dominica is changing. Both maximum and minimum temperatures have increased in the recent past.
- The warming trend is expected to continue. The country is projected to be warmer by up to 1.3°C by the 2050s, and between 2 and 3 degrees by the end of the century.
- Winter months will see marginally larger increases in temperature than summer months.
- The frequency of very hot days and nights will increase, while the number of very cool days and nights will decrease.
- The country is likely to be drier in the mean. Projections are for up to 20% drier by midcentury when models show more consensus about the trend, and up to 50% drier by 2100.
- July-August will likely be drier.
- The seasonality of Dominica will be largely unchanged. The cooler (with respect to late season temperatures) dry early months and wet hotter late months will still prevail.
- Hurricane intensity is likely to increase (as indicated by stronger peak winds and more rainfall) but not necessarily hurricane frequency.
- Caribbean sea levels are projected to rise by up to 0.24 m by midcentury.
- Sea surface temperatures in the Caribbean are projected to warm, up to approximately 2°C by the end of the century.
- ENSO's impact on Dominican rainfall (early and late season) will likely continue, given projections of the phenomenon's continued occurrence in the future.

## 4. EXPOSURE ANALYSIS

The term exposure is used to indicate those elements-at-risk that are subject to potential losses. Important elements-at-risk that should be considered in analysing potential damage of hazards are population, building stock, essential facilities and critical infrastructure. Critical infrastructure consists of the primary physical structures, technical facilities and systems which are socially, economically or operationally essential to the functioning of a society or community, both in routine circumstances and in the extreme circumstances of an emergency (UN-ISDR, 2009).

This exposure analysis involves developing a hazard profile for the school by assigning ratings (from 0 to 3) to the parameters listed in Table 4-1 below and averaging the parameter scores for each hazard. Based on the average scores, the school is characterized by the degree of exposure to each hazard and further assigned an **Overall Exposure Index** (sum of the average scores for all hazards).

The objective is to quantify the school's level of exposure and subsequently the potential impact (direct or indirect) of a specific hazard on people, essential facilities, and property. This will enable school administrators, the Ministry of Education and other key decision makers to have a better understanding of the hazards that present the highest risk to the school and focus planning efforts on making schools safer in this context.

The consultants used existing data and available hazard maps to determine the level of exposure of the school to specific hazards. Table 4-2 presents the findings of the exposure analysis.

Based on the hazard identification (Section 3) and the exposure analysis, the Belles Primary School has a high degree of exposure to hurricanes and tropical storms (and associated wind) and flooding. Additionally, the school is highly likely to be affected by the climate change projections made for the area and the region (Section 3.3). Based on this analysis, the school has been assigned an exposure index of **11.7 (Moderate)**; Table 4-2). It would be prudent for the school to prioritise all hazards that have been given a rating of high or moderate.

OVERALL EXPOSURE INDEX		
0 - 4	VERY LOW	
5 - 9	LOW	
10 - 14	MODERATE	
15 - 19	HIGH	
20 - 24	VERY HIGH	

**TABLE 4.1: PARAMETERS AND RANKINGS USED IN EXPOSURE ANALYSIS (SOURCE: ADAPTED FROM FEMA HAZARD ANALYSIS WORKSHEET)**

PARAMETER	RANKINGS	SCORE
Frequency	<b>Highly Likely:</b> Near 100% probability in next year.	3
	<b>Likely:</b> Between 10 and 100% probability in next year, or at least one chance in 10 years.	2
	<b>Possible:</b> Between 1 and 10% probability in next year, or at least one chance in next 100 years.	1
	<b>Unlikely:</b> Less than 1% probability in next 100 years.	0
Warning (potential speed of onset)	Minimal (or no) warning.	3
	6 to 12 hours warning.	2
	12 to 24 hours warning.	1
	More than 24 hours warning.	0
Severity	<b>Catastrophic:</b> Multiple deaths; Complete shutdown of facilities for 30 days or more; More than 50% of property is severely damaged.	3
	<b>Critical:</b> Injuries and/or illnesses result in permanent disability; Complete shutdown of critical facilities for at least two weeks; More than 25% of property is severely damaged.	2
	<b>Limited:</b> Injuries and/or illnesses do not result in permanent disability; Complete shutdown of critical facilities for more than 1 week; More than 10% of property is severely damaged.	1
	<b>Negligible:</b> Injuries and/or illnesses are treatable with first aid; Minor quality of life lost; Shutdown of critical facilities and services for 24 hours or less; Less than 10% of property is severely damaged.	0


**TABLE 4.2: FINDINGS OF THE EXPOSURE ANALYSIS FOR THE BELLES PRIMARY SCHOOL**

HAZARD	COMMENTS	FREQUENCY		WARNING TIME		SEVERITY		DEGREE OF EXPOSURE	
		RANKING	SCORE	RANKING	SCORE	RANKING	SCORE	RANKING	AVERAGE SCORE
<b>Hurricanes and Tropical Storms</b>	<p>This school like the entire island and region was found to be exposed to the Wind Hazard.</p> <p>While hurricanes are a natural part of the region's climate system, the recent increase in intense hurricane activity has redefined the meaning of Extreme Wind or Hurricane Exposure. More intense hurricanes that carry higher wind speeds and more precipitation or expected (Figure 4-1).</p>	Likely	2	12-24 hrs	1	Catastrophic	3	HIGH	2.0
<b>Flooding (from hurricanes, storms or extreme rainfall events)</b>	<p>The school is located in a flood prone zone and drainage infrastructure at the school needs improvement (Figure 4-2). Flash floods are also likely.</p>	Likely	2	6-12 hrs	2	Critical	2	HIGH	2.0
<b>Drought</b>	<p>Drought impacts the entire island of Dominica, with ranging severity but high likelihood.</p>	Likely	2	24+ hrs	0	Limited	1	MODERATE	1.0
<b>Storm Surge</b>	<p>The school is not exposed to storm surge (Figure 4-3).</p>							NOT EXPOSED	
<b>Landslide</b>	<p>The school is exposed to landslides (Figure 4-4).</p>	Likely	2	6-12 hrs	2	Limited	1	MODERATE	1.7
<b>Earthquake</b>	<p>Seismic activity is a risk for all Caribbean islands. The lack of warning and potential for catastrophic impacts suggest that the school has a high exposure to earthquakes. (Figure 4-5).</p>	Likely	2	Minimal (or no warning)	3	Catastrophic	3	HIGH	2.7

**TABLE 4.2: FINDINGS OF THE EXPOSURE ANALYSIS FOR THE BELLES PRIMARY SCHOOL**

HAZARD	COMMENTS	FREQUENCY		WARNING TIME		SEVERITY		DEGREE OF EXPOSURE	
		RANKING	SCORE	RANKING	SCORE	RANKING	SCORE	RANKING	AVERAGE SCORE
<b>Volcano</b>	The island has very high exposure to volcanic hazards, and an eruption is expected in the next 100 years. The school is not in the immediate zone of the volcano; however, the level of exposure persists (Figure 4-6).	<b>Possible</b>	<b>1</b>	<b>Minimal (or no warning)</b>	<b>3</b>	<b>Catastrophic</b>	<b>3</b>	<b>HIGH</b>	<b>2.3</b>
<b>Tsunamis</b>	The school is not exposed to tsunamis.							<b>NOT EXPOSED</b>	
<b>OVERALL EXPOSURE INDEX</b>								<b>MODERATE</b>	<b>11.7</b>

**FIGURE 4.1: DOMINICA WIND HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)**

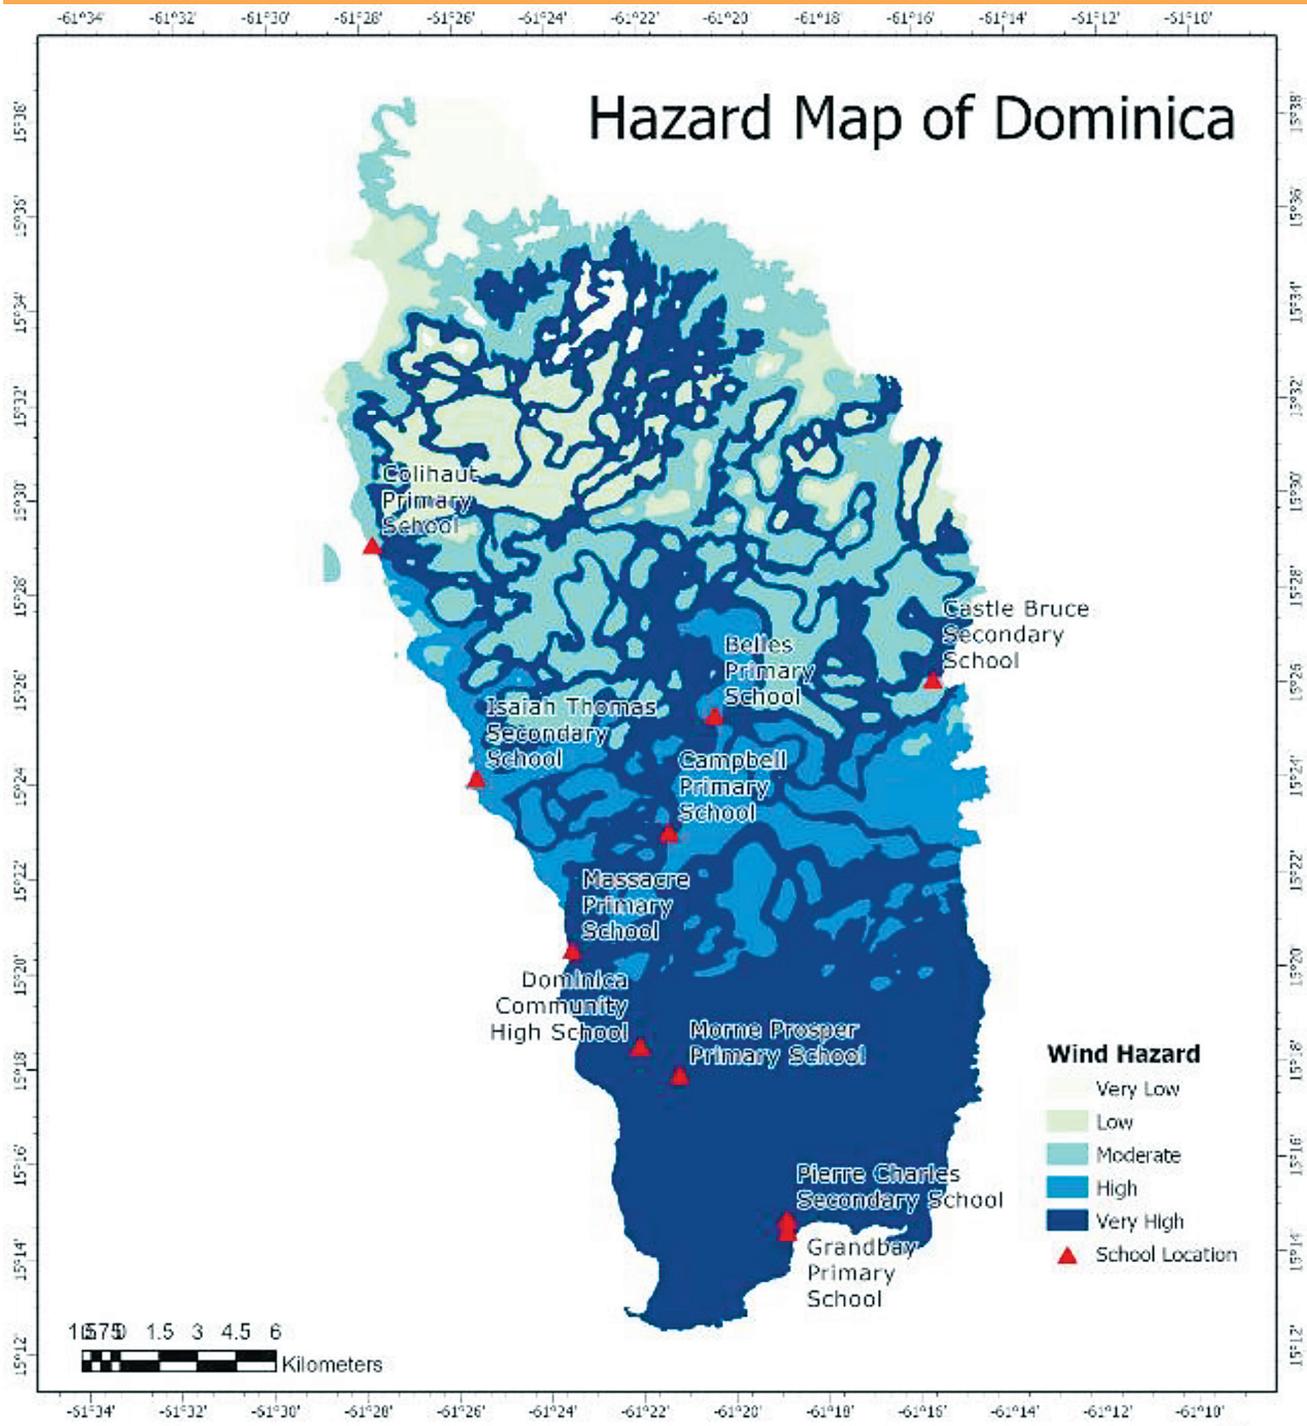


Project: Develop/enhance National Safe School Polices in four Borrowing Member Countries (BMCs), conduct hazard assessments of 33 schools across six BMCs, and prepare costed action plans for each of the schools based on the results of the assessments.

Data Source: CHARIM Geonode <http://charim-geonode.net/>

Scale: 1:236,097



**FIGURE 4.2: DOMINICA FLOOD HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)**

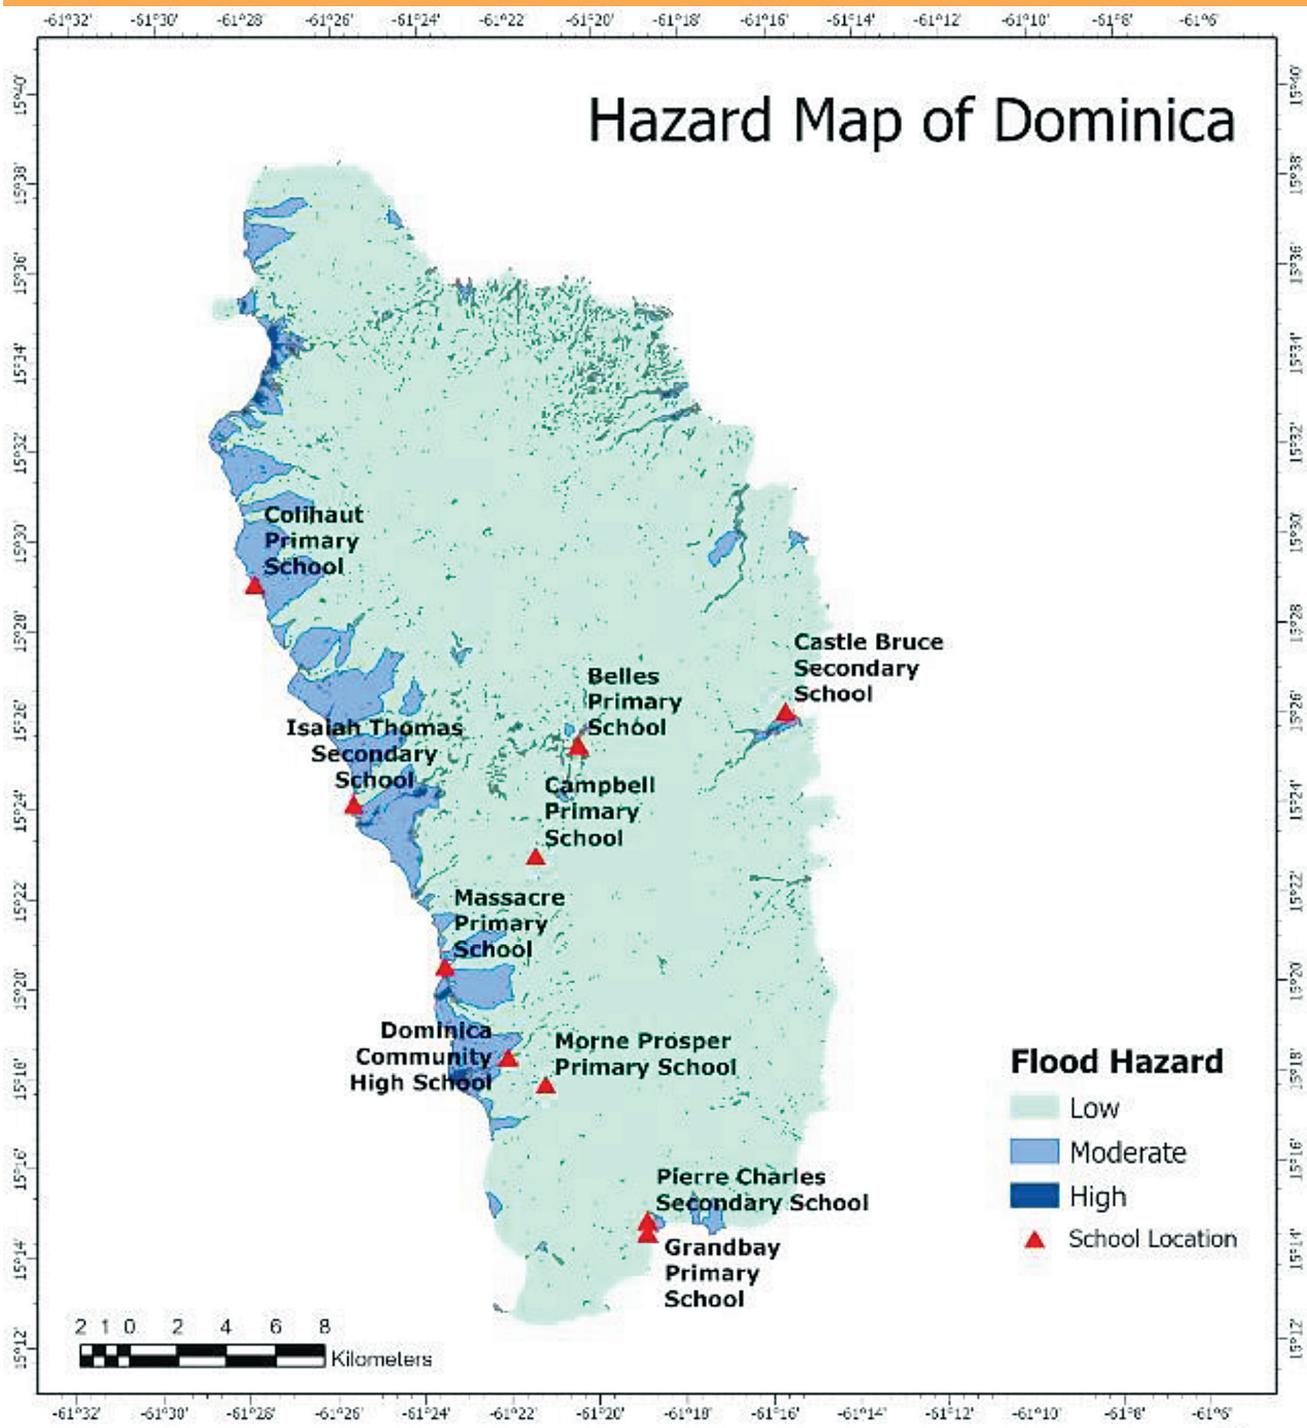


Project: Develop/enhance National Safe School Policies in four Borrowing Member Countries (BMCs), conduct hazard assessments of 33 schools across six BMCs, and prepare costed action plans for each of the schools based on the results of the assessments.

Data Source: CHARIM Geonode <http://charim-geonode.net/>

Scale: 1:250,000



**FIGURE 4.3: DOMINICA STORM SURGE HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)**

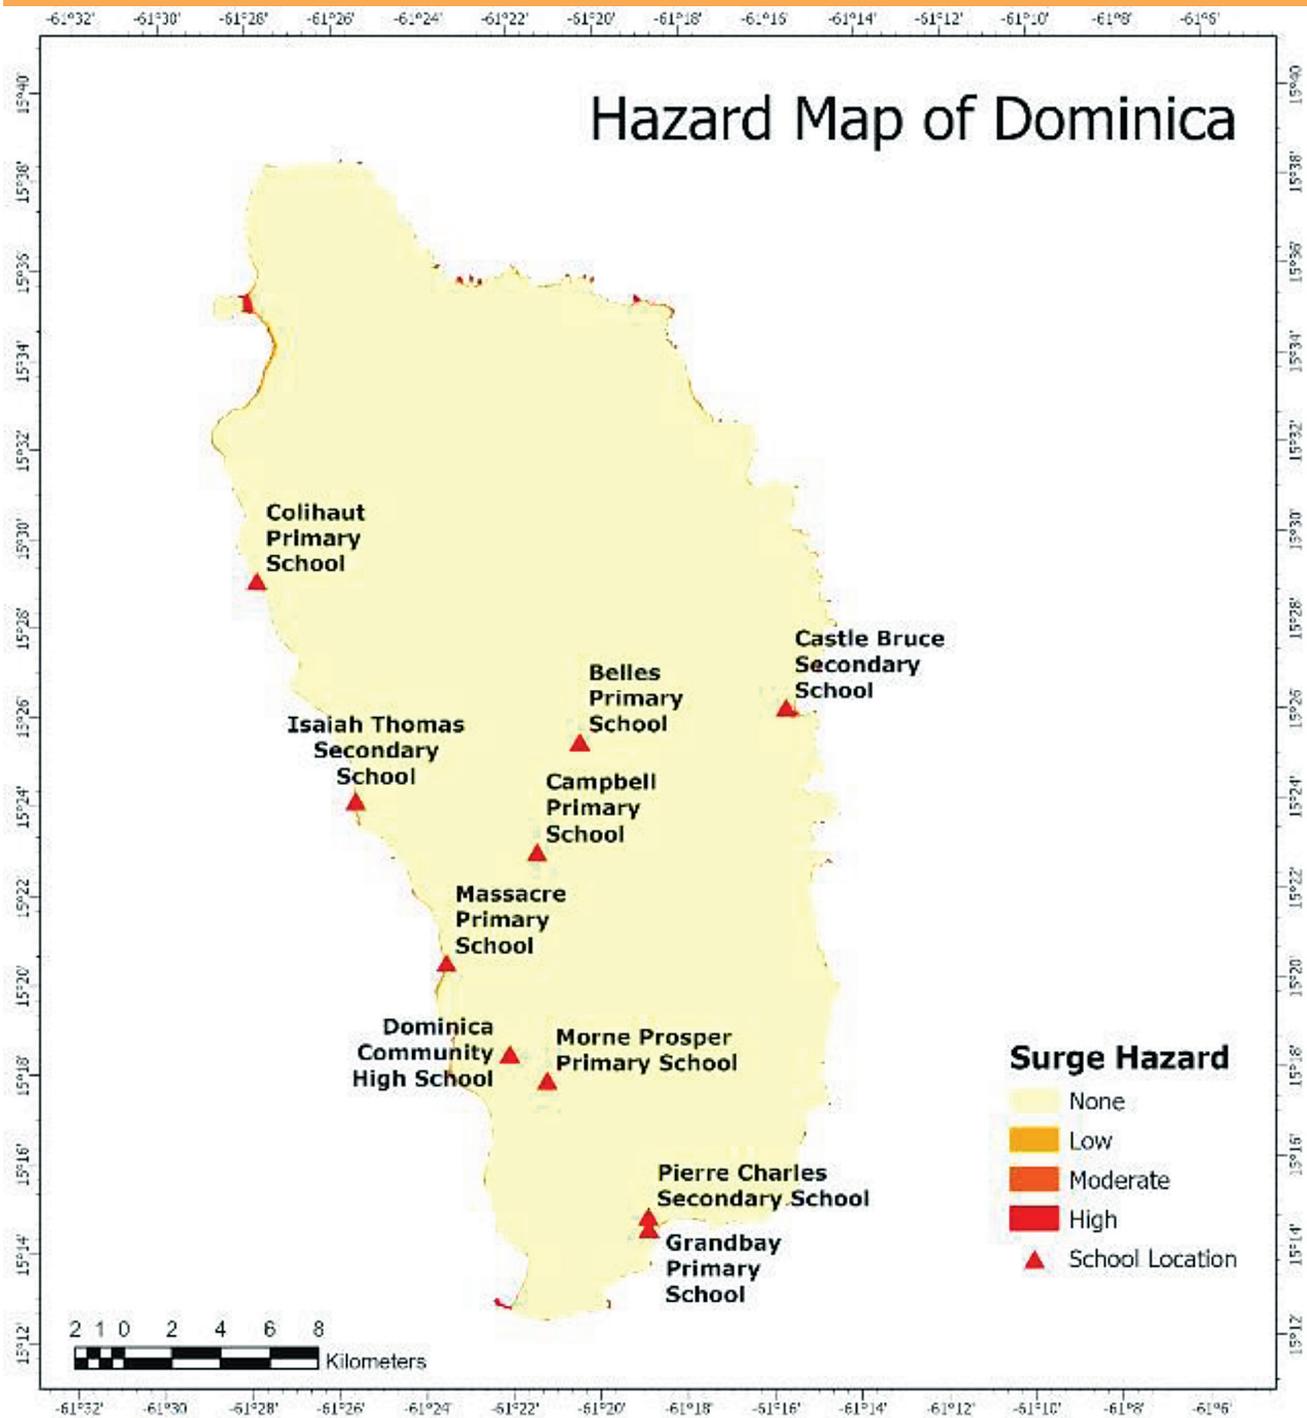


**Project:**  
 Develop/enhance National Safe School Polices in four Borrowing Member Countries (BMCs), conduct hazard assessments of 33 schools across six BMCs, and prepare costing action plans for each of the schools based on the results of the assessments.

**Data Source:** CHARIM Geonode <http://charim-geonode.net/>

**Scale:** 1:250,000



**FIGURE 4.4: DOMINICA LANDSLIDE HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)**

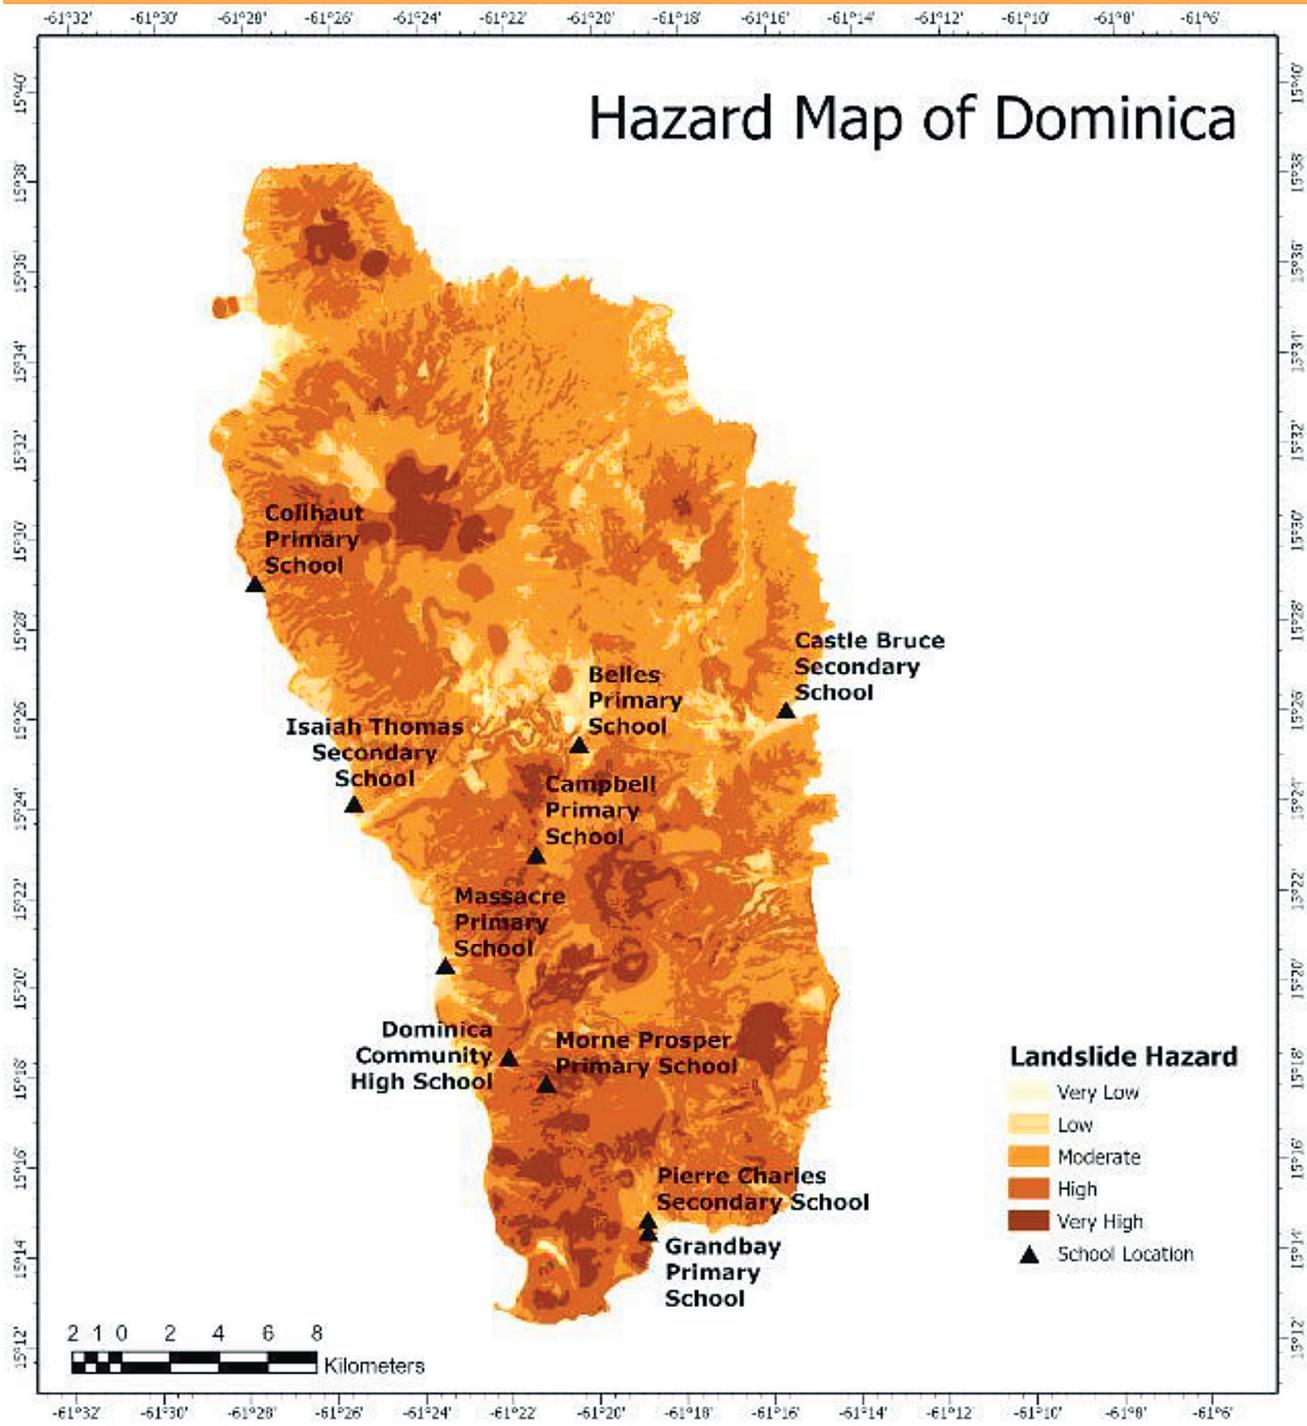


**Project:**  
 Develop/enhance National Safe School Polices in four Borrowing Member Countries (BMCs), conduct hazard assessments of 33 schools across six BMCs, and prepare costed action plans for each of the schools based on the results of the assessments.

**Data Source:** CHARIM Geonode <http://charim-geonode.net/>

**Scale:** 1:250,000



**FIGURE 4.5: DOMINICA EARTHQUAKE HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)**

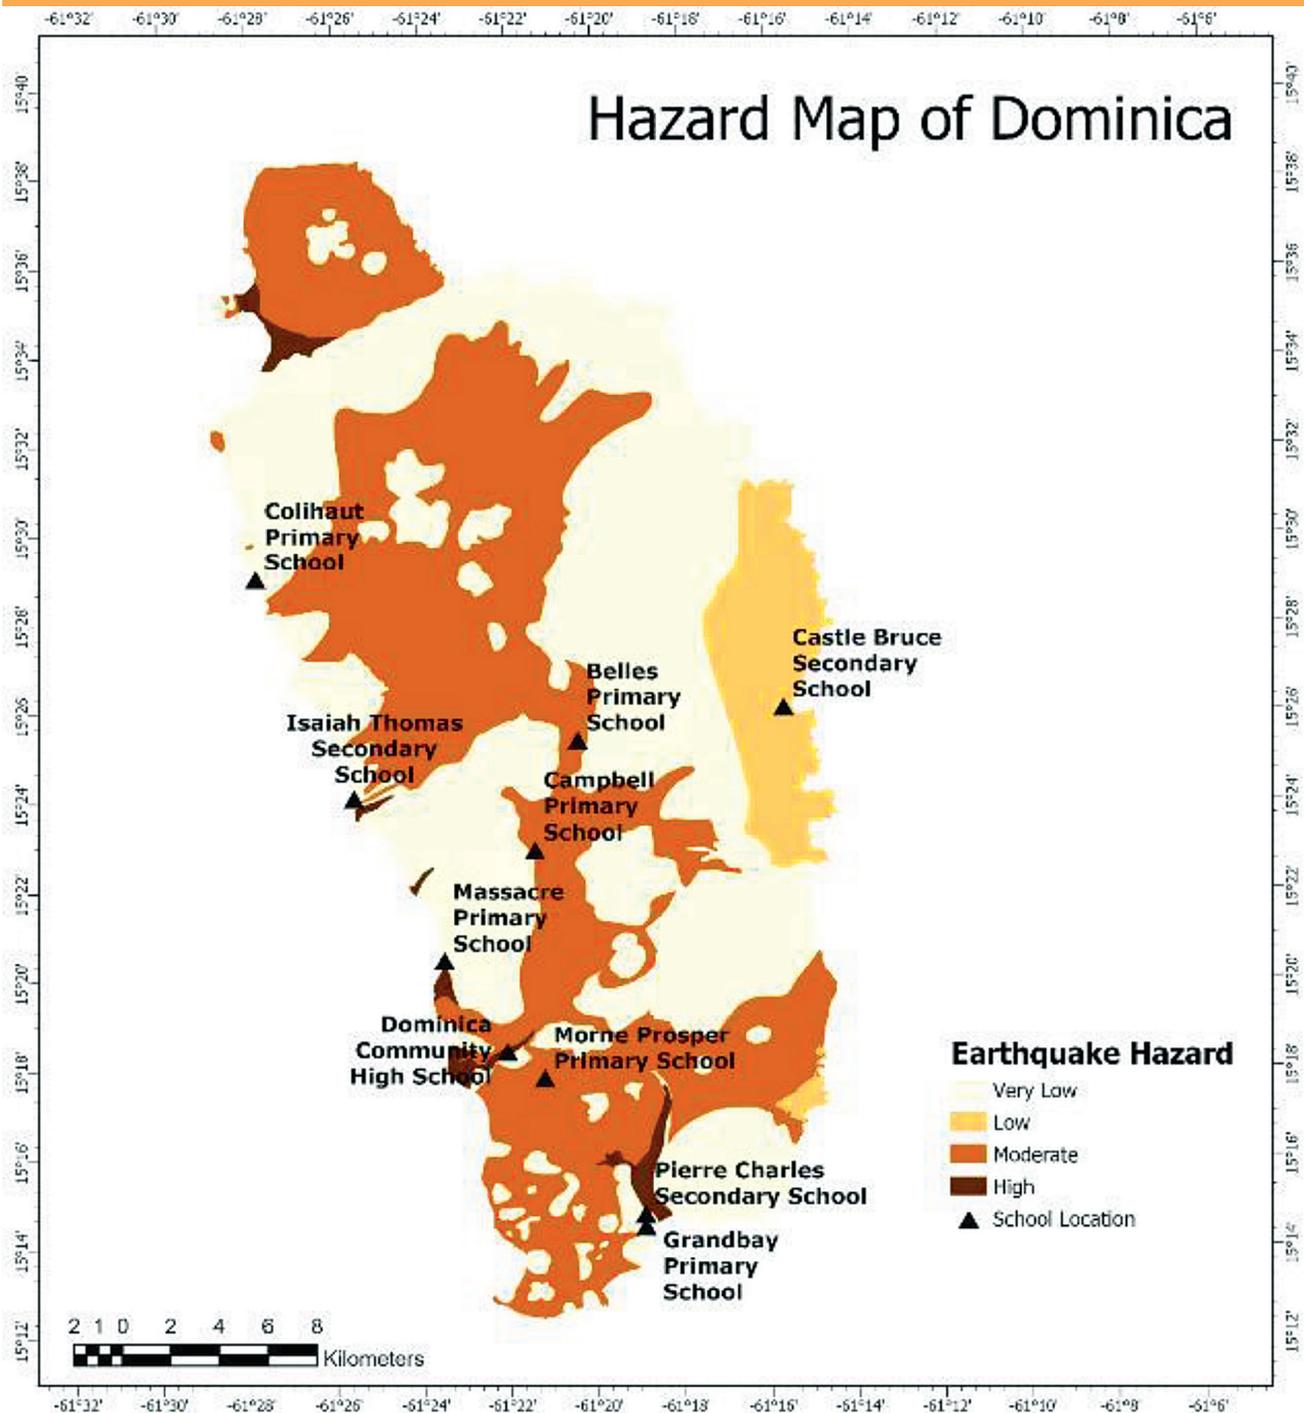


**Project:**  
 Develop/enhance National Safe School Polices in four Borrowing Member Countries (BMCs), conduct hazard assessments of 33 schools across six BMCs, and prepare costed action plans for each of the schools based on the results of the assessments.

**Data Source:** CHARIM Geonode <http://charim-geonode.net/>

**Scale:** 1:250,000



**FIGURE 4.6: DOMINICA VOLCANO HAZARD MAP SHOWING LOCATIONS OF SCHOOLS ASSESSED (MAY 2019)**

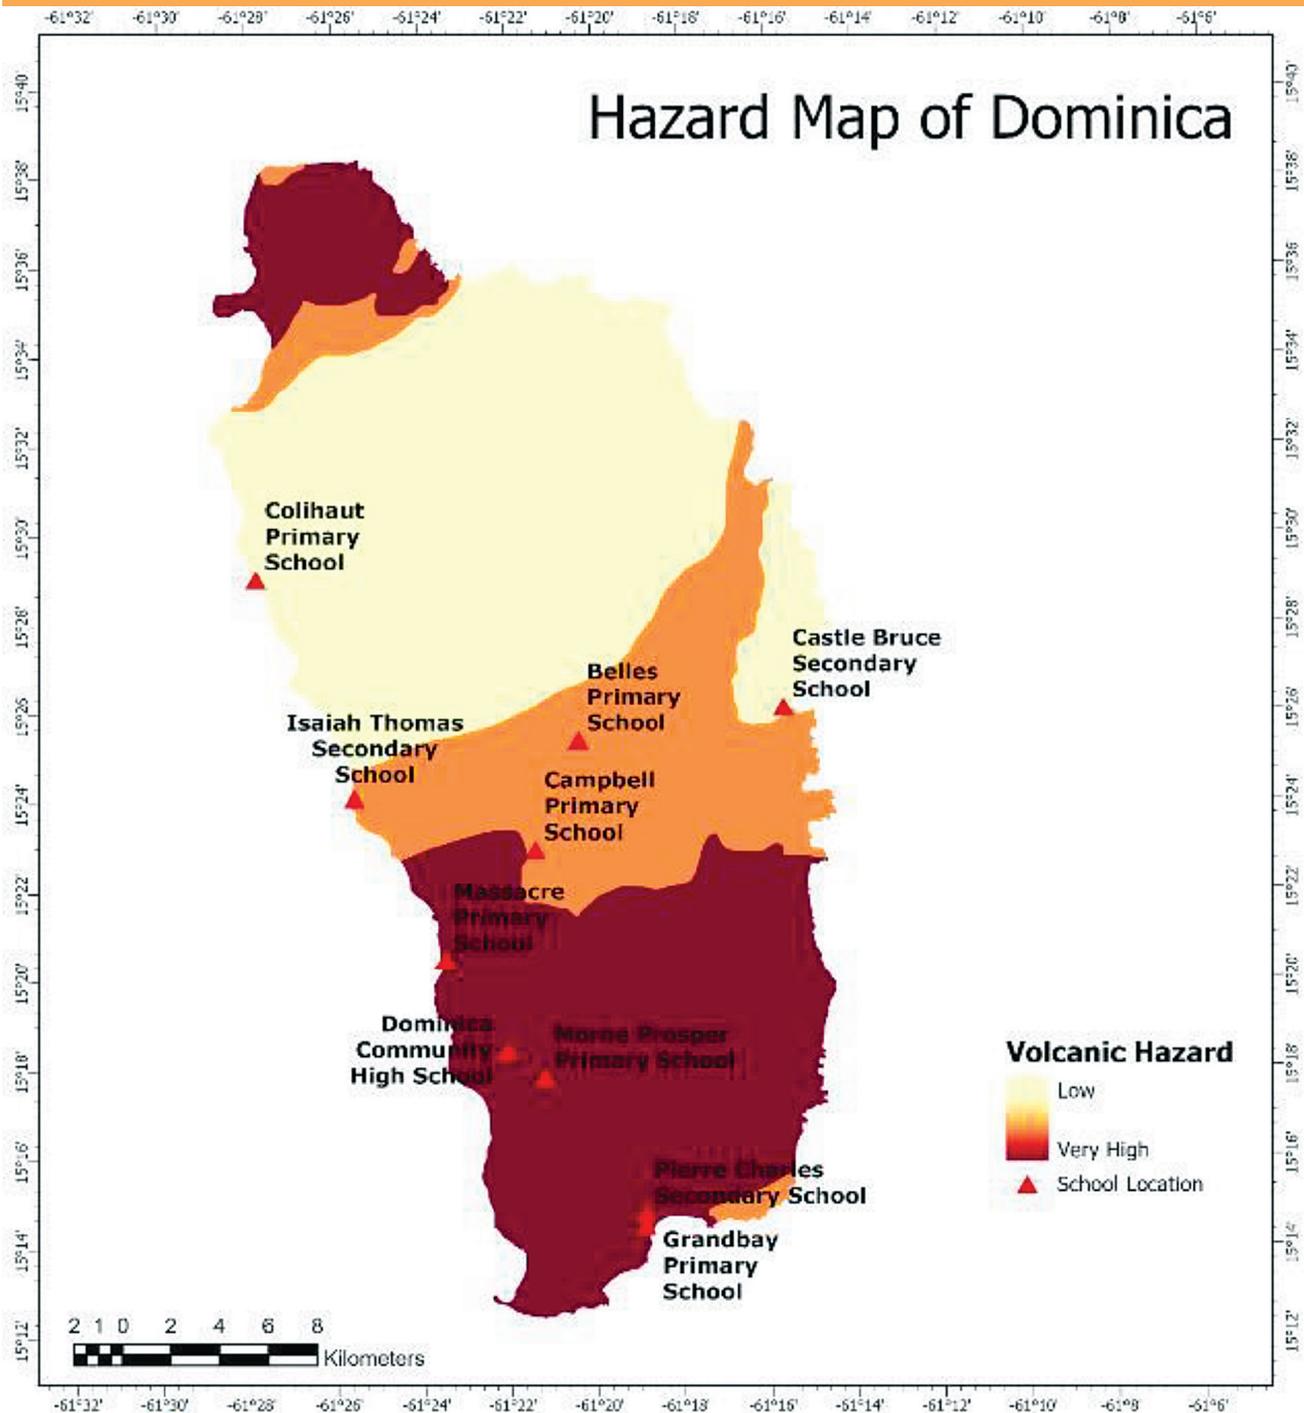

**Project:**  
Develop/enhance National Safe School Polices in four Borrowing Member Countries (BMCs), conduct hazard assessments of 33 schools across six BMCs, and prepare costed action plans for each of the schools based on the results of the assessments.

**Data Source:** CHARIM Geonode <http://charim-geonode.net/>

**Scale:** 1:250,000



## 4.1 OTHER HAZARDS

Comprehensive school emergency planning utilizes an “all-hazards” approach, which considers a wide range of possible threats and hazards. It includes those that might take place in the community and surrounding area that could impact the school. Examples include:

### 1. Technological Hazards

- Hazardous materials in the community from industrial plants, major highways or railroads
- Hazardous materials in the school e.g. gas leaks, sewage breaks or laboratory spills
- Infrastructure failure e.g. dam, electricity, water, communications or technology systems

### 2. Biological Hazards

- Infectious diseases
- Contaminated food outbreak
- Water contamination
- Toxic materials present in schools e.g. mould, asbestos, substances in school science laboratories

### 3. Adversarial, Incidental and Human-Caused Hazards

- Fire
- Medical Emergency
- Intruder
- Active shooter/Threats of violence
- Fights
- Gang violence
- Bomb threat
- Child abuse
- Cyber attack
- Suicide
- Missing student or kidnapping
- Off-site emergencies
- Dangerous animal
- Riots

During interviews with persons at the Belles Primary School, a major concern was proximity to the highway and the lack of infrastructure to protect persons on the premises in the case of an accident/collision. Only a chain-link fence separates the small compound from the highway. The school administration expressed that they requested for a wall or more substantial barrier to be put in place through the District Education Office of the Ministry of Education (MoE). They have also since take the initiative to have safety signs made, however at the time of the assessment these had not yet been erected (Figure 4-7); given that students must cross the road to access evacuation assembly points/safety areas, this issue is paramount. The school also does not have any security personnel on staff, however there is a perimeter fence that is fully intact, and they have a close working relationship with residents of the Belles village where they are located.

FIGURE 4.7: SAFETY SIGNS TO BE ERECTED AT BELLES PRIMARY SCHOOL (MAY 2019)



Persons interviewed also expressed that there is a need to improve management of the school when being used as a shelter (after Hurricane Maria in 2017, a report was filed with the MoE).

It is recommended that the school determine which of the above are priority hazards to be included in the revised EMP.

## 5. ADAPTIVE CAPACITY

The adaptive capacity analysis describes the ability of the school to accommodate potential damage, to take advantage of opportunities, or to respond to consequences with minimum disruption or minimum additional cost (Climate Impacts Group, King County, Washington, and ICLEI-Local Governments for Sustainability, 2007). It describes the capacity of the school to learn from previous experiences and to apply those lessons to cope in future.

In the context of what the school may be exposed to (Section 3), the analysis below seeks to determine (among other things):

- If the school is already able to accommodate changes
- If there are any barriers to the school to accommodate changes
- If the rate of the projected change is likely to be faster than the adaptability of the school
- If there are efforts already underway to address impacts of various hazards in the school

To develop an overall index of adaptive capacity, 24 indicators were selected and grouped according to five determinants of adaptive capacity (Table 5-1) in the context of the hazards that may impact each school (Section 3). The indicators were selected using information garnered using the MSSP toolkit checklists, interviews and desk review of other existing data and information (Smit et al 2001, Yohe and Tol, 2002). The index was calculated by first aggregating the scores for the individual indicators to obtain a determinant value, which were then aggregated to an overall score to obtain an **Overall Adaptive Capacity Index**.

OVERALL ADAPTIVE CAPACITY INDEX		
0 - 4	VERY LOW	
5 - 9	LOW	
10 - 14	MODERATE	
15 - 19	HIGH	
20 - 24	VERY HIGH	

This approach provides a holistic perspective on the school's ability to plan for, design and implement effective adaptation strategies or to react to evolving hazards and stresses which may ultimately reduce the likelihood of the occurrence and or the severity of harmful outcomes resulting from hazards. It considers all elements of Comprehensive Disaster Management (Preparedness, Mitigation, Response and Recovery)<sup>2</sup>. The analysis is presented in Table 5-2.

**TABLE 5.1: DETERMINANTS OF ADAPTIVE CAPACITY USED IN SCHOOL ASSESSMENT (ADAPTED FROM SMIT ET AL. 2001)**

DETERMINANT	RATIONALE
<b>Economic</b>	<ul style="list-style-type: none"> <li>■ Greater economic resources increase adaptive capacity</li> <li>■ Lack of financial resources limits adaptation options</li> </ul>
<b>Information and skills</b>	<ul style="list-style-type: none"> <li>■ Lack of informed, skilled and trained personnel reduces adaptive capacity</li> <li>■ Greater access to information increases likelihood of timely and appropriate adaptation</li> </ul>
<b>Infrastructure and Technology</b>	<ul style="list-style-type: none"> <li>■ Lack of technology limits range of potential adaptation options</li> <li>■ Less technologically advanced regions are less likely to develop and/or implement technological adaptations</li> <li>■ Greater variety of infrastructure can enhance adaptive capacity, since it provides more options</li> <li>■ Characteristics and location of infrastructure also affect adaptive capacity</li> </ul>
<b>Institutional</b>	<ul style="list-style-type: none"> <li>■ Well-developed social institutions help to reduce impacts of climate- related risks and therefore increase adaptive capacity</li> <li>■ Policies and regulations may constrain or enhance adaptive capacity</li> </ul>
<b>Natural/Ecological /Climate</b>	<ul style="list-style-type: none"> <li>■ Elements of the natural, physical or ecological environment of a region may enhance or limit the possibilities for adaptation (including projected climate change impacts)</li> </ul>

**TABLE 5.2: SUMMARY OF ADAPTIVE CAPACITY ANALYSIS FOR BELLES PRIMARY SCHOOL (2019)**

DETERMINANT	INDICATOR	SCORE	COMMENTS
<b>Institutional</b>	<p><b>1.</b> Is there a national policy on climate change adaptation and/or comprehensive disaster management (or related) for the education sector? [YES = 1; NO = 0]</p>	<b>0</b>	<p>Dominica has addressed climate adaptation at the policy level through the preparation of a national climate change adaptation strategy, and through the “Economics of Climate Adaptation Initiative”, the Mainstreaming Adaptation to Climate Change (MACC) Project, and the Pilot Programme for Climate Resilience (PPCR). While education is not listed as a vulnerable or priority sector with regards to climate change in the Second National Communication.</p> <p>Dominica has requested support from the OECS to increase climate change resilience of the education sector through a regional approach. The reason is that there is a priority to reduce the impacts of climate change-related extreme weather events, including the disruption of education services and high costs of damages, in their national plans.</p> <p>Dominica is also signatory to the Antigua and Barbuda Declaration on School Safety and is in the process of implementing the Model Safe School Programme.</p>
	<p><b>2.</b> Have there been additions to the curriculum that integrate climate change/disaster preparedness/emergency management? [YES = 1; NO = 0]</p>	<b>0</b>	At the time of this assessment, there was no curriculum integration.
	<p><b>3.</b> Is an updated emergency management or disaster management plan in place? [YES = 1; NO = 0]</p>	<b>1</b>	Yes, the plan was developed in collaboration and based on assessments done by Isra-Aid.
	<p><b>4.</b> Do the plans address priority hazards based on previous assessment(s)? [YES = 1; NO = 0]</p>	<b>1</b>	Yes, the plan addresses priority hazards including hurricanes, floods, volcanic events and fires.
	<p><b>5.</b> Is there a designated environmental/health &amp; safety officer, emergency response team or related position/team? [YES = 1; NO = 0]</p>	<b>0</b>	At the time of this assessment, there was no officer or related position in place.
<b>Information and Skills</b>	<p><b>6.</b> Has the school done a walk through to identify and prioritize hazards for the population and visitors? [YES = 1; NO = 0]</p>	<b>1</b>	Previous assessments conducted by Isra-Aid.

**TABLE 5.2: SUMMARY OF ADAPTIVE CAPACITY ANALYSIS FOR BELLES PRIMARY SCHOOL (2019)**

DETERMINANT	INDICATOR	SCORE	COMMENTS
<b>Information and Skills</b>	<p><b>7.</b> Are all teachers and school staff assigned roles in the overall response, pre-, during and post-hazard event? [YES = 1; NO = 0]</p>	1	Yes, all persons are assigned roles and responsibilities for disaster/emergency management.
	<p><b>8.</b> Have staff received training in emergency/disaster management? [YES = 1; NO = 0]</p>	0	At the time of the assessment, teachers had not received any training however a program was included in the EMP submitted to the MoE.
	<p><b>9.</b> Are there regular drills with staff, parents and students? [YES = 1; NO = 0]</p>	1	Yes, the school conducts simulation exercises with teachers, staff and students.
	<p><b>10.</b> Is the school able to manage an event independently if help is not immediately available? E.g. fire extinguishers, first aid kits, triage? [YES = 1; NO = 0]</p>	0	While the school is equipped with necessary equipment for managing an emergency, teachers and staff are not trained in first aid or fire suppression.
<b>Infrastructure and Technology</b>	<p><b>11.</b> Does the school have reserve water storage with adequate supply for at least 3 days? [YES = 1; NO = 0]</p>	0	The school does not currently store water.
	<p><b>12.</b> Does the school employ water conservation strategies to adapt to current usage or plan for future changes to water supply? [YES = 1; NO = 0]</p>	0	No, there are no initiatives underway or planned.
	<p><b>13.</b> Does the school actively harvest rainwater? [YES = 1; NO = 0]</p>	0	No, rainwater is not currently harvested.
	<p><b>14.</b> Does the school employ energy conservation/efficiency mechanisms? [YES = 1; NO = 0]</p>	1	Yes, some areas of the school use energy efficient bulbs (LED).

**TABLE 5.2: SUMMARY OF ADAPTIVE CAPACITY ANALYSIS FOR BELLES PRIMARY SCHOOL (2019)**

DETERMINANT	INDICATOR	SCORE	COMMENTS
Infrastructure and Technology	<b>15.</b> Is there back up electrical power? [YES = 1; NO = 0]	0	This is an area for improvement as there is no back up electrical power.
	<b>16.</b> Does the school employ other green practices? E.g. recycling, greenhouse/garden, green policy etc? [YES = 1; NO = 0]	0	While the school has an active 4H club, plans to recycle, compost and plant a garden had not yet been implemented at the time of the assessment.
	<b>17.</b> Can the building withstand the impacts of a hazard in its current condition? [YES = 1; NO = 0]	1	Yes. There is no immediate concern about the structural integrity of the building.
	<b>18.</b> Have school buildings/plant been repaired or retrofitted to the building code? [YES = 1; NO = 0]	1	Yes, the school has recently been renovated. Repairs and retrofit are recommended in Costed Action Plan (Section 8).
<b>ARE THERE ANY EXISTING BARRIERS TO ADAPTATION?</b>			
Natural / Ecological / Climate	<b>19.</b> Physical or ecological limits? E.g. landscape/physical location limits range of adaptation options to priority hazards? [YES = 1; NO = 0]	1	No, the location of the school does not compromise the degree of adaptation possible.
	<b>20.</b> Is climate change likely to exacerbate any of the current hazards? [YES = 1; NO = 0]	0	Based on climate projections, the current hazards are projected to be exacerbated.
	<b>21.</b> Is the rate of climate change likely to outpace adaptation efforts? [YES = 1; NO = 0]	0	Dominica has been cited as one of six Caribbean countries listed in the world's top-40 climate "hot spots". The impacts of certain hazards are already being experienced islandwide.

**TABLE 5.2: SUMMARY OF ADAPTIVE CAPACITY ANALYSIS FOR BELLES PRIMARY SCHOOL (2019)**

DETERMINANT	INDICATOR	SCORE	COMMENTS
<b>Infrastructure and Technology</b>	<p><b>22.</b> Technological limits? Availability of technological options for adaptation e.g. warning systems/ impacts of disruptions on any technology-based emergency communication resources; electronic data storage.</p> <p>[YES = 1; NO = 0]</p>	1	The school has an electronic bell.
<b>Economic</b>	<p><b>23.</b> Financial barriers? E.g. Lack of resources may limit the ability of some schools to afford proposed adaptation mechanisms.</p> <p>[YES = 1; NO = 0]</p>	0	The school is funded by the government.
<b>Information and Skills</b>	<p><b>24.</b> Information or cognitive barriers (individuals tend to prioritize the risks they face, focusing on those they consider – rightly or wrongly – to be the most significant to them at that point in time)? E.g. concern about one type of risk is heightened while worry about other risks decreases; lack of experience of climate-related events inhibits adequate responses.</p> <p>[YES = 1; NO = 0]</p>	1	Based on interviews with school officials, there is an acknowledgement of the range of natural and man-made hazards facing the school. They are cognizant of the climate-related hazards.
<b>OVERALL ADAPTIVE CAPACITY INDEX</b>		<b>11</b>	<b>MODERATE</b>

## 5.1 DESCRIPTION OF STRUCTURE

The investigation consisted of a visual review of the exterior and interior elements such as walls, slab, columns and beams as well as a general walk-through to examine the existing cracks and other defects which may exist.

Based on our observations, there is no immediate concern about the structural integrity of the building. The primary and secondary structural members are in a very satisfactory condition with no visible signs of distress or imminent failure. We anticipate that the building should perform adequately for its life. Storm water drainage system needs to be enhanced and regularly monitored and maintained.

**TABLE 5.3: RESULTS OF BUILDING CONDITION ASSESSMENT (MAY 2019)**

	<b>BUILDING 1 &amp; 2</b>
<b>Number of Storeys per Building:</b>	<b>1</b>
<b>Floor Type:</b>	<p><b>Description:</b> Reinforced concrete.</p> <p><b>Observation:</b> Floor slab in generally good condition.</p>
<b>Wall / Partition Type:</b>	<p><b>Description:</b> Reinforced masonry in good condition.</p>
<b>Roof Structure:</b>	<p><b>Description:</b> Reinforced concrete roof slab and beam in generally good condition.</p>
<b>Roof Covering:</b>	<p><b>Description:</b> Reinforced concrete roof slab in generally good condition.</p>
<b>Repairs / Retrofitting Conducted:</b>	<b>Building has recently been refurbished.</b>
<b>Is there Disabled Access/ Special Needs Access to the Building?</b>	<b>None</b>
<b>Approx. Age of Each Building</b>	<b>More than 10 years</b>
<b>Building Use</b>	<b>Classrooms, Toilets</b>
<b>Overall Condition</b>	<b>Good</b>

## 5.1.1 SITE OBSERVATIONS / DISCUSSION

The below presents a summary of the observations made of the physical plant:

### EXTERIOR

#### WALLS

There were no signs of water ingress through the external walls which were in good condition.

#### SLAB & BEAMS

Found to be in generally good condition.

#### COLUMNS

Found to be in good condition generally.

### INTERIOR

#### WALLS

Interior Masonry walls were in good condition.

#### WINDOWS

No broken windows were observed. The building envelope is not compromised which is ideal condition for an extreme wind event.

#### DOORS

Doors were in good condition.

**Photographs obtained during our inspection are provided in the Appendix.**

## 6. VULNERABILITY ASSESSMENT

The final step in the vulnerability assessment process is to combine the findings of exposure and adaptability to determine how and where the school is vulnerable. It is important to note that the vulnerability assessment does not remain static, it can improve or worsen with time. Changes can occur within the school, such as implementation of preparedness activities, and/or new threats may emerge. These can all influence the school's overall vulnerability.

The Belles Primary School has been classified as having an **overall moderate exposure**, with the primary hazards being hurricanes & tropical storms (and associated wind) and flooding. The analysis of the adaptive capacity revealed that the school has several barriers and limitations, as such their capacity to adjust to change (induced by the hazards to which they are exposed), to moderate potential damages, to take advantage of opportunities, or to cope with the consequences is **moderate**. In particular, the need to have teachers fully trained in first aid or some aspect of disaster/emergency management is critical given the school's relatively remote location. There are additional strategies that the school can employ to improve their adaptive capacity, however these may come at significant cost (presented in Section 8). As the school is government funded, this may further constrain the school's ability to adapt to climate change. As such, the Belles Primary School can be characterised as **moderately vulnerable**.

## 7. SUMMARY FINDINGS

Overall, the persons interviewed at Belles Primary School had a good understanding of the hazards that need to be addressed at the school as priority. Our team's assessment suggests that maintenance is a priority task for the school administration which is an integral component of disaster management and risk reduction. The critical areas for improvement included training for all teachers in Emergency First Response (EFR), erecting a wall and/or signage at the front of the school that borders the highway and storm water drainage upgrades.

Note: The number of students broken down by sex is included in Appendix A.

### KEY STRENGTHS:

Belles Primary School possesses some of the key elements to ensure quality education for children:

- The school has been recently renovated based on findings of previous assessments done by Isra-Aid; several aspects of safety were considered including an intact perimeter fence, covered drains, and emergency doors that open outwards.
- The school has an up-to-date emergency management plan (EMP) that addresses some of the priority safety hazards. Teachers and staff are all assigned respective roles and responsibilities and have been trained on the plan. Evacuation routes and assembly areas have also been defined in the plan.
- Safety simulation exercises have recently been conducted at the school.
- Students are aware to contact a teacher or staff member in the event of any hazard or emergency.
- The principal maintains a list of repairs to be done and priority issues for safety that is submitted to the District Education Officer of the Ministry of Education.

#### AREAS FOR IMPROVEMENT:

- The School Safety Plan needs to critically examine information about the student population (such as number of students broken down by age group and sex), as the number, age and ability of the students can make a significant difference in the event of an emergency.
- At the time of the assessment, teachers and staff had not been trained in first aid or emergency first response. Safety signage around the school was limited, particularly along the highway (no pedestrian crossing etc). As mentioned, there was a request to have a more substantial barrier between the school and the highway.
- At the time of the assessment, there was no water storage at the school.
- The school currently has no security personnel/watchmen or groundskeeper.
- At the time of the assessment, there was no designated/exclusive storage available for hazardous/chemical materials. It was expected that once the early childhood school construction was completed, space would become available.

FIGURE 7.1: IMAGES HIGHLIGHTING SAFETY STRENGTH AT BELLES PRIMARY SCHOOL (MAY 2019)



**FIGURE 7.2: IMAGE ILLUSTRATING PROXIMITY OF SCHOOL TO MAJOR HIGHWAY AND LACK OF SAFETY SIGNAGE (MAY 2019)**



Section 8 – Improvement Plan and Costed Action Plan provided specific actions and timelines for recommendations on improving the overall safety of the school. Additional selected photographs can be found in the Appendix.

## 8. IMPROVEMENT PLAN AND COSTED ACTION PLAN

The table below summarizes our opinion of recommended improvements and budgets for capital expenditures (remedial works, repairs, retrofitting) identified by this report. Expenditures that are expected to be managed as part of normal operations are not shown. The budgets assume a prudent level of ongoing maintenance. It should be noted that costs excluded engineering indirect costs. Opinions of cost also excluded any local taxes.

The proposed estimated cost to undertake the remedial work is **Two Hundred and Fifty-Nine Thousand, One Hundred Dollars Eastern Caribbean Currency (XCD\$259,100.00)**.

**TABLE 8.1: IMPROVEMENT PLAN AND COSTED ACTION PLAN FOR BELLES PRIMARY SCHOOL (MAY 2019)**

RECOMMENDATION	TASK	RESPONSIBLE PARTY	FUNDS REQUIRED	TIMEFRAME SHORT-MEDIUM -LONG TERM	RESULT
<b>Emergency Planning and Management</b>	Erect safety signage around the school premises.	School administration in coordination with Disaster Management Agency(ies) and other relevant entities.		Short	Improved Emergency Planning and Management
	Run drills and simulations to sensitize teachers and students.	School administration in coordination with Disaster Management Agency(ies) and other relevant entities.		Short	
	Complete Emergency First Response (EFR) or First Aid Training for all teachers and staff.	School administration in coordination with Disaster Management Agency(ies) and other relevant entities.		Short	
	Include in the school safety plan disaggregated data on student population (age, gender) as this will better inform disaster and emergency planning. This can be updated as needed and appended to the plan.	School administration in coordination with Disaster Management Agency(ies) and other relevant entities.		Short	

**TABLE 8.1: IMPROVEMENT PLAN AND COSTED ACTION PLAN FOR BELLES PRIMARY SCHOOL (MAY 2019)**

RECOMMENDATION	TASK	RESPONSIBLE PARTY	FUNDS REQUIRED	TIMEFRAME SHORT-MEDIUM -LONG TERM	RESULT
<b>Sustainability and Greening</b>	Create an environmental club for students to lead on the development of various activities/initiatives aimed at “greening” the school i.e. increasing environmental sustainability through awareness and action.	Principal and/or Safety Committee.		Short	Increased awareness and sensitization.
<b>On-site drainage of water (rainwater, wastewater from sinks, etc.) needs to be addressed</b>	Upgrade of storm drains to include additional flood protection from adjacent existing waterway.	Ministry of Education in collaboration with Department of Works.	XCD\$36,500	Medium	Improved drainage.
<b>Other Infrastructural upgrades</b>	Repair roof covering, ceiling and roof drains with current Building Code Standards.	Ministry of Education in collaboration with Department of Works.  *some smaller projects can be undertaken by school/community/private organization as a special project.	XCD\$22,400	Medium	Increased building resilience; improved school plant.
	Upgrade toilet block to include renewal of septic and soak-away.		XCD\$25,600	Long	
	Upgrade of doors and windows to hurricane resistant standards.		XCD\$18,500	Medium - Long	
	Construct new water storage.		XCD\$44,000	Medium - Long	
	Repairs to electrical wiring complete with new fixtures.		XCD\$28,600	Medium	
	Painting to affected areas.		XCD\$15,000	Short	
	Repair defective or damaged external and internal walls and slabs.		XCD\$18,500	Medium	

**TABLE 8.1: IMPROVEMENT PLAN AND COSTED ACTION PLAN FOR BELLES PRIMARY SCHOOL (MAY 2019)**

RECOMMENDATION	TASK	RESPONSIBLE PARTY	FUNDS REQUIRED	TIMEFRAME SHORT-MEDIUM -LONG TERM	RESULT
<b>Secure physical plant</b>	<ul style="list-style-type: none"> <li>■ Adequately train and equip security personnel with requisite skills/tools to secure the compound.</li> <li>■ Review contractual obligations of current security service providers – particularly performance clauses.</li> <li>■ Explore options for other service providers by issuing a new request for proposal.</li> </ul>	Ministry of Education in collaboration and other relevant Ministries /agencies.	Quotations to be solicited by the Ministry of Education and other relevant Ministries /agencies.	Medium	Improved safety and security of assets.
	Contingency				

**NOTE:**

The recommended actions should commence in the following time periods:  
 Short term= 1-3 yrs; Medium term= 3-5 yrs; Long term= > 5 yrs

# 9. REFERENCES

ACAPS Disaster Profile: Dominica. 2018.

Centre for Science in the Earth System (The Climate Impacts Group Joint Institute for the Study of the Atmosphere and Ocean University of Washington and King County, Washington In association with ICLEI- Local Governments for Sustainability, 2007. Preparing for Climate Change: A Guidebook for Local, Regional and State Governments

CCRIF. (2013). Dominica Country Risk Profile. George Town, Cayman Islands: CCRIF.

DeGraff, J.V., 1987. Landslide hazards on Dominica West Indies - Final Report. Organization of American States, Washington, D.C., 25 pgs.

DeGraff, J.V., Bryce, IL, Jibson, ILW., Mora, S., and Rogers, C.T., 1989. Landslides: Their extent and significance in the Caribbean, in Brabb, E.E. and B.L. Harrod (eds.), Landslides: Extent and Economic Significance. A.A. Balkema: Rotterdam, p. 51-80.

Global Facility for Disaster Risk Reduction (GFDRR). 2010. Disaster Risk Management in Latin America and the Caribbean Region – GFDRR Country Notes.

Commonwealth of Dominica. 2001. First National Communication of the Commonwealth of Dominica under the United Nations Framework Convention on Climate Change (UNFCCC). Environmental Coordinating Unit, Ministry of Environment, Natural Resources, Physical Planning and Fisheries.

Commonwealth of Dominica. 2012. Second National Communication of the Commonwealth of Dominica under the United Nations Framework Convention on Climate Change (UNFCCC). Environmental Coordinating Unit, Ministry of Environment, Natural Resources, Physical Planning and Fisheries.

Intergovernmental Panel on Climate Change [IPCC]. 2013. Climate Change 2013: The Physical Science Basis. Fifth Assessment Report of the Intergovernmental Panel on Climate Change. Cambridge, United Kingdom: Intergovernmental Panel on Climate Change, Cambridge University Press.

Simpson, M. C., Clarke, J. F., Scott, D. J., New, M., Karmalkar, A., Day, O. J., Taylor, M., Gossling, S., Wilson, M., Chadee, D., Stager, H., Waithe, R., Stewart, A., Georges, J., Hutchinson, N., Fields, N., Sim, R., Rutty, M., Matthews, L., and Charles, S. 2012. CARIBSAVE Climate Change Risk Atlas (CCCRA) - Dominica. DFID, AusAID and The CARIBSAVE Partnership Department of Emergency Management (DEM). 2014. Country Document for Disaster Risk Reduction: Dominica, 2014

Smit, B. and O. Pilifosova. 2003. From adaptation to adaptive capacity and vulnerability reduction. In J.B. Smith, R.J.T. Klein and S. Huq, eds., Climate change, adaptive capacity and development. Imperial College Press, London.

Smit, B., et al. 2001. Adaptation to climate change in the context of sustainable development and equity. In J.J. McCarthy and O.F. Canziani, eds., Climate Change 2001: Impacts, adaptation and vulnerability. Contribution of Working Group III to the 3rd Assessment Report of the Intergovernmental Panel on Climate Change

United Nations Office for Disaster Risk Reduction (UNISDR). 2009. Global Assessment Report on Disaster Risk Reduction: Risk and Poverty in a Changing Climate – Invest Today for a Safer Tomorrow.

United Nations Office for Disaster Risk Reduction (UNISDR). 2013. Global Assessment Report on Disaster Risk Reduction: From Shared Risk to Shared Value – The Business Case for Disaster Risk Reduction.

## Websites

FEMA Hazard Analysis Worksheet. Retrieved September 2019.  
<https://www.fema.gov/hazard-identification-and-risk-assessment>

Global Climate Risk Index 2019. Retrieved September 2019.  
[www.germanwatch.org/cri](http://www.germanwatch.org/cri)

# 10. APPENDICES

## APPENDIX A: MSSP ASSESSMENT TOOLKIT RESULTS

### GENERAL INFORMATION

**TABLE 10.1: VITAL INFORMATION FOR SCHOOL SAFETY**

NAME OF SCHOOL	BELLES PRIMARY SCHOOL
Type of school (Pre-school, Primary, Secondary, Tertiary)	PRIMARY
Is facility private and public?	PUBLIC
Location	BELLES, ST. JOESPH, DOMINICA
Name of Head Teacher or Principal	VILINE CHRISTPHER
Telephone	(767) 613 4224
Email	vyle49@hotmail.com
Year building(s) constructed	Less than 20 years ago
Buildings contained on the school compound	2
Number of classrooms	-
Total school population	51
Students	45
Teachers	5 (All Female)
Non-teaching Staff	1
Number of first aid kits available	1
Number of fire extinguishers throughout the buildings?	1
Natural disaster in the past	YES - Water Damage
The type of event and the time it occur	HURRICANE MARIA (2017)
Repairs as a result of the event	YES - The school has recently been renovated
School designated as an emergency shelter	YES

## OVERALL SCORES

**TABLE 10.2: SCHOOL SAFETY ASSESSMENT SUMMARY**

CHECKLIST	SCORE (%)	CRITICAL STANDARDS MET
Safety	55%	NO
Green	37%	NO

The above scoring is calculated based on the questions and Critical Standards applying to secondary schools only.

## SAFETY ASSESSMENT SCORES

**TABLE 10.3: SAFETY ASSESSMENT SUMMARY SCORES**

SAFETY THEME	SCORE (%)	CRITICAL STANDARDS MET
Disaster Planning	73%	YES
Emergency Planning	44%	YES
Safety Admin	32%	
Medical Emergencies	84%	NO
Physical Plant	58%	NO
Physical Safety	35%	
Protection of the Person	45%	
Hazardous chemicals and materials	5%	NO

## GREEN ASSESSMENT SCORES

**TABLE 10.4: GREEN ASSESSMENT SUMMARY SCORES**

SAFETY THEME	SCORE (%)	CRITICAL STANDARDS MET
Sustainability Management	39%	NO
Natural Resources	26%	NO
Indoor Environment	33%	NO
Hazardous Chemicals and Materials	35%	NO
Facility and Grounds Management	52%	NO
Food Service	73%	YES

## APPENDIX B: SELECTED PHOTOGRAPHS



■ PANORAMIC VIEW SHOWING EXISTING FACILITY WITH EXPANSION WORK IN PROGRESS



■ EXPANSION WORK IN PROGRESS



■ FRONT ELEVATION



■ REAR ELEVATION



■ REAR ELEVATION



■ CONNECTING WALKWAYS



■ MAIN ENTRANCE



■ STORM DRAINS



■ STORM DRAINS

Please note that the photographs are not an illustration of all defects at the property. They are to give you guidance on its general condition. The photographs should not be viewed in isolation.

Please note that there may be some defects in the photographs which are not referred to in the main text.

## APPENDIX C: NSSPC - DOMINICA

COUNTRY: DOMINICA						
#	FIRST NAME	LAST NAME	GENDER	JOB TITLE	ORGANIZATION	CONTACT EMAIL
EG.	Jane	Doe	Female	Education Officer - South Division	Ministry of Education	jane.doe@moe.eg.org
1	Melina	Fontaine	Female	Current Education Officer (CEO)	MOE	chiefeduoff@education.gov.dm
2	Dr. Jeffery	Blaize	Male	ACEO	MOE	blaizej@yahoo.com
3	David	Maximea	Male	DEO	MOE	earl31@hotmail.com
4	Cynthia	Joseph	Female	DEO	MOE	ceanjayy@gmail.com
5	Queen	Thomas	Female	DEO	MOE	felixia21@gmail.com
6	Magaret	Jules Royer	Female	DEO	MOE	margoroyer2007@hotmail.com
7	Octavia	Timothy	Female	Coordinator/ Special Education	MOE	octimj98@gmail.com
8	Mervin	Alexander	Male	President DAT	DAT	-
9	Dionne	Durand Smith	Female	Communication Specialist	MOE	dionnedurand@gmail.com
10	Veda	George	Female	Coordinator Early Childhood	MOE	coordinatorccd@dominica.gov.dm
11	Donaldson	Frederick	Male	ODM	-	donalsonfrederick@gmail.com
12	Andy	Prosper	Male	Engineer	Public Works	andpros@hotmail.com
13	Natalie	Murphy	Female	President	Dominica Association of Persons with Disability	-
14	Sawana	Fabien	Female	Program Director	IsraAid	sfabien@israaid.org

## APPENDIX D: ORGANISATIONS CONSULTED



### Organizations consulted:

- Ministry of Education
- Physical Planning Division
- Ministry of Public Works
- Principals
- National Safe School Committee
- Isra-Aid
- Early Childhood Unit
- Special Education Unit
- Dominica Association of Local Govt
- Engineers Without Borders
- Office of Disaster Management (ODM)
- Climate Resilience Execution Agency for Dominica (CREAD)





